

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

T 1N, R 33E., W.M.


Corner Code No. C-5

Note: Monument marked as shown below

**History of original corner establishment:**

The most recent original record, by U.S. Indian Surveyor C. E. Redfield, indicates this corner was re-established in 1919. Redfield's notes do not call for the type of monument set in 1919.

Redfield's notes were found in the BIA Realty Section vault at the Umatilla Agency.

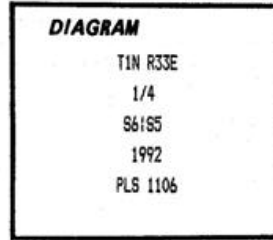

Corner No. \_\_\_\_\_  
Compass Declination: 18.0°

**Description of corner evidence found:**

Found witness corner monument 20 feet East of corner position, which has been removed from the ground by farming and roadbuilding operations.

Re-established corner position at the intersection of a well defined fence berm approaching from the East and the old North-South roadbed of Public Road No. 3089. This corner position was confirmed by survey. See Survey No. 92-23-B.

**Description of monument and accessories established to perpetuate the original location of this corner:**

Set a 2 1/2" brass cap on 1 1/4" by 30" G.I.P. 29 1/2" in ground from which:

- A 5/8" by 30" rebar bears N 51°W - 11.0'.
- A 5/8" by 30" rebar bears N 60 1/2°E - 21.97'.
- A 5/8" by 30" rebar bears S 64°E - 23.81'.
- A 5/8" by 30" rebar bears S 51°W - 11.25'.

Each rebar reference monument is capped with a yellow plastic cap stamped "W.R. WELLS, PLS 1106". Set a steel fence post near each reference monument with a "Bearing Object" sign attached.  
Set a steel fence post 3.6' West of monument with a Survey Marker sign attached.

Buried witness corner monument alongside of the new corner monument.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

Office of..... County of.....  
State of..... I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....  
..... by ..... (DEPUTY)  
(COUNTY OFFICIAL)