

OREGON CORNER RESTORATION FORM

Section: 25, 36, 30, 31 Township: 3N Range: 32E, 33E
County: Umatilla Date: 2/11/2011

Corner Designation: 3N33V01

Section corner common to Sections 25, 36, T3NR32E; 30, 31, T3NR33E.

<input checked="" type="checkbox"/>	Condition Report Only
<input type="checkbox"/>	Not Found
<input type="checkbox"/>	Remonumented
<input type="checkbox"/>	Unrecorded
<input type="checkbox"/>	Surveyed in
<input checked="" type="checkbox"/>	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Thompson in 1864. He set a post in a mound of earth.
In 2001 Haddock set a 2 1/4" brass cap at the intersection of the Township line and an East-West plowline.


Monuments and Accessories Found: (Condition and Source):

A 2 1/2" brass cap.
A 5/8" iron rebar w/RPC PLS 953 lies N 68° 30' W, 48.74'. Haddock found this accessory at N 68° 09' 26" W, 48.73' in V1-01-81C.
A 5/8" iron rebar w/RPC PLS 953 lies S 63° 30' W, 51.55'. Haddock found this accessory at S 63° 58' 48" W, 51.58' in V1-01-81C.

Diagram

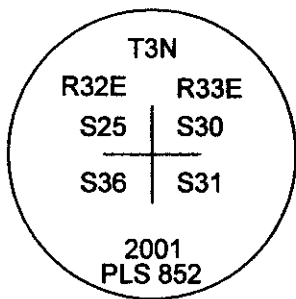

Sketch

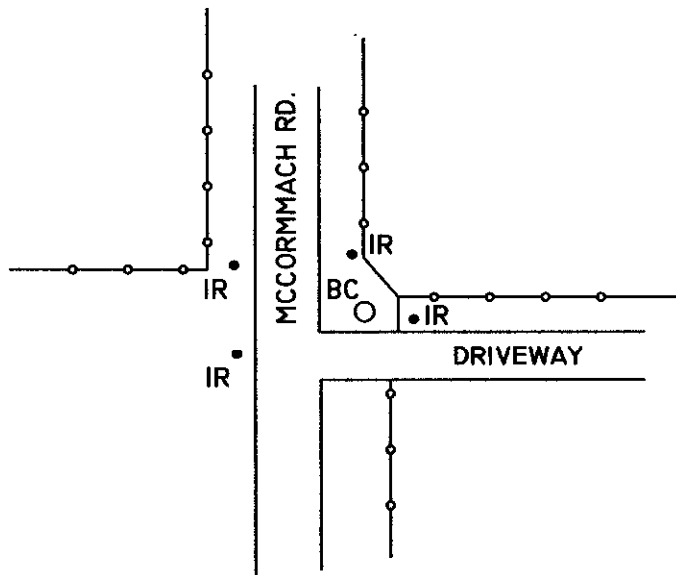

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N747457.31
E8650325.09

Monument(s) Set (Procedures and Description):

None.

References Set:

A 5/8" x 30" iron rebar w/RPC #43406 lies S 87° 30' E, 22.37', at a steel fence post.
A 5/8" x 30" iron rebar w/RPC #43406 lies N 27° W, 23.92', at a wooden gate post.

Location and Comments:

The corner is located 2 miles South of the intersection of Fulton Rd. and McCormmach Rd.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert Douglas English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:

Date: 2/10/2012
Rec'd By: [Signature]
No. 12-094-C

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055