


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-7

History of original corner establishment:
Corner was originally established by Rufus S. Moore,
U.S. Deputy Surveyor, under Contract No. 451,
dated June 12, 1882. Surveyor General records state:
Set a post 3 ft. long 3 ins. sq. 24 ins. in
ground for 1/4 sec. cor. marked 1/4 S on W. face.
from which:
A pine 15 ins. in dia. bears N 22° E 49 lks dist.
marked 1/4 S BT.
A pine 11 ins. in dia. bears S 24° E 49 lks dist.
marked 1/4 S BT.

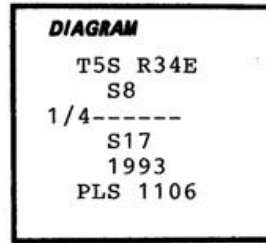

Description of corner evidence found:

None. Corner re-established by single proportionate measurement between
the Northwest corner and Northeast corner of Section 17. The corner
falls in the East cutslope embankment of road 5160.

Corner area was searched for a total of 3 hours with a 2 person crew on 2
separate occasions. 1 1/2 hours of professional land surveyor search time
was spent. A search radius of 150 feet was covered. The corner area has been
disturbed by logging and road construction.

Description of monument and accessories established to perpetuate the
original location of this corner:

At position determined by survey...

Drove a 5/8" by 30" iron pin with 1 1/2" alum. cap into the fractured rock
road cut. Cap is and marked as shown in corner diagram.

Attached sign 54-9 to steel fence post, set 4.5 feet East of monument.

New accessories established:

- A 9 1/2" western larch bears N 41° E -114.4 feet, scribed: 1/4S8 BT.
A 6" western larch bears N 15° W - 95.2 feet, scribed: 1/4S8 BT.
A 5 1/2" lodgepole pine bears S 73° W - 42.7 feet, scribed: 1/4S17 BT.
A 5 1/2" lodgepole pine bears S 35° W -124.7 feet, scribed: 1/4S17 BT.
A reference monument(5/8"X30"iron pin with 1 1/2" aluminum cap) bears N 69° E
19.46 feet, marked: T5SR34E S8 RM 19.46FT 1993 PLS 1106.
A reference monument(5/8"X30"iron pin with 1 1/4" aluminum cap) bears S 22 1/2° E
25.45 feet, marked: T5SR34E RM S17 25.45FT 1993 PLS 1106.

New bearing trees have a brass washer stamped 'PLS 1106' nailed to face
of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band
around each bearing tree. Reference monuments have sign 54-3 attached
to the iron pin, steel guard post with sign 54-9 attached nearby.

I hereby certify that the above corner was
was properly re-established to U.S.F.S standards
by me on October 22,1993.

Compass declination 18° East.

Office of... County Surveyor... County of... Umatilla
State of... Oregon... I hereby certify that the within instrument was filed in this office
for record on the... day of... 19...

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

renews 12-31-94

(COUNTY OFFICIAL)

(DEPUTY)

RECEIVED BY

Form R6-7100-57 (9/71)

Umatilla County Surveyor
Date 8-4-94
Rec'd By KK
No. 94-106-C

*GPO-591-971, 1988