

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 4/14/94

CORNER DESIGNATION: T-17. East 1/4 corner Section 27, T2N., R32E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Most recent official GLO Survey was made by James P. Currin and James Noland, under Special Contract dated May 4, 1887. They set a stone 12 x 10 x 8 ins., 8 inches in the ground for 1/4 Sec. corner, marked 1/4 on West face. Redug pits 18 x 18 x 12 ins., N & S. from stone 5 1/2 ft. distant and raised a mound of earth 1 1/2 ft. high, 3 1/2 ft. base alongside.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T2N R32E
1/4
S27 | S26
1994
PLS 1106

MONUMENT SET: Re-established corner position by single proportion measurement between the Northeast and Southeast corners of Section 27, and set a 2 1/2" brass cap on a 1 1/4" x 30" galvanized iron pipe, 29" in the ground, with a mound of earth and stone to the cap, (marked as shown in the monument detail).

New Accessories:


Set steel fence post with witness sign 1 foot North of monument.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 43° E-18.8 feet, top buried 1 foot below ground.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 41° E-15.1 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 35 1/2° W-20.8 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 40° W-31.8 feet.
Attached bearing object sign to each iron pin. Attached witness sign to each steel fence post.

LOCATION & COMMENTS: Corner falls in East edge of a scab patch at the West edge of a farmed field.

COMPASS DECLINATION: 18° East.
FIRM/AGENCY: William R. Wells, PLS
P.O. Box 1696
Pendleton, Oregon 97801

Surveyor's Seal

Party Chief: Robert D. English
Notes: Robert D. English
Witness: F. Scot Munro

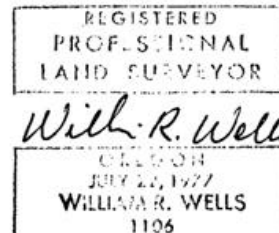

renewal 12-31-94