

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 4/14/94

CORNER DESIGNATION: X-9. East 1/4 corner section 32, T2N., R32E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: The original survey was made by Daniel Chaplin, under Contract No. 107, dated September 21, 1864. At the corner point, Chaplin set a post for 1/4 Sec. corner in mound of earth, with charred stake, pits and etc., as per instructions.

MONUMENT AND ACCESSORIES FOUND: None. Corner falls in farmed field.

MONUMENT MARKING DETAIL:

T2N R32E
 1/4
S32 | S33
 1994
 PLS 1106

MONUMENT SET: Re-established corner by single proportion measurement between the Northeast and Southeast corners of Section 32. At re-established corner position, set a 2 1/2" brass cap on a 1 1/4" x 30" galvanized iron pipe, 42" in the ground, (marked as shown in the monument detail).

New Accessories:


A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 35° E-14.4 feet, top set 1 foot below ground.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 43° E-17.7 feet, top set 1 foot below ground.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears S 63° W-19.0 feet, top set 1.2 feet below ground.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 42° W-15.5 feet, top set 1.1 feet below ground.

LOCATION & COMMENTS: Corner falls in farmed field.


COMPASS DECLINATION: 18° East.
FIRM/AGENCY: William R. Wells, PLS
 P.O. Box 1696
 Pendleton, Oregon 97801

Surveyor's Seal

Party Chief: Robert D. English
Notes: Robert D. English
Witness: F. Scot Munro

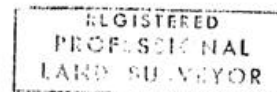

William R. Wells

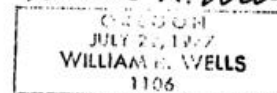

renews 12-31-94