


T 2N, R 33E., W.M. CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Corner Code No. N-15
Note: Monument marked as shown below

History of original corner establishment:

Public Records indicate this corner was last established by Currin and Nolan, U.S. Deputy Surveyors, under their Special Contract in 1887.

No record of corner recovery or re-establishment was found in C.E. Redfield's fragmentary field notes.

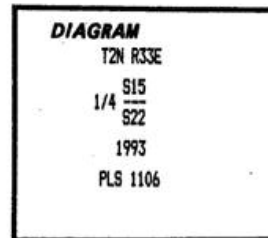

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Farming and a large ditch has removed all evidence of the original corner.

Re-established corner by single proportion measurement between the re-established Southwest and Southeast Corners of Section 15.

Description of monument and accessories established to perpetuate the original location of this corner:

Set 2 1/2" brass cap on 1 1/4" by 30" galvanized iron pipe with top of pipe buried 12" below ground surface.

Bearing Objects to corner:

- A 5/8" by 30" iron pin bears S 60°W - 24.6', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 5/8" by 30" iron pin bears S 65°E - 29.8', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 1/2" by 15" iron pin bears N 52 1/2°E - 15.2'.
- A 1/2" by 15" iron pin bears N 78°W - 14.4'.

All pins have a Bearing Object sign wired on, and are buried with the top of pin at least 12" below ground surface.

Set an 8' steel fence post 1.3' East of monument, and attached a Witness Corner sign.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

expires 12-31-94

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

93-53-C