

# OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 05/3/05

CORNER DESIGNATION: 5N35, G-05, The West Quarter Corner of Section 8.

## PREVIOUS RENEWALS/SURVEYS ETC.:

Corner originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post; drove charred stake; dug pits & raised mound, as per instructions.

In June, 1900, J.W. Kimbrell does not find the corner and re-establishes it in Record of Private Surveys, Survey No. 125. Kimbrell's notes state he "set stone for 1/4 sec. cor."

## MONUMENT AND ACCESSORIES FOUND:

None.

## MONUMENT MARKING DETAIL:

T5N R35E  
1/4  
S7|S8  
2005  
PLS 1106

## MONUMENT SET:

Held a fence corner with fences East, South and North 27° West as best remaining evidence of the original corner. At a point 0.6' South of fence corner post, set a 2 1/2" brass cap on a 1 1/4" x 30" galvanized iron pipe with cap 2" above ground level. Cap marked as shown in Monument Marking Detail.

### New accessories:

A 5/8" x 24" iron rebar with a 1 1/4" yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", with cap 1" above ground level bears East, 20.7 feet.

A 5/8" x 24" iron rebar with a 1 1/4" yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", with cap 1" above ground level bears East, 51.2 feet.

A 5/8" x 24" iron rebar with a 1 1/4" yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", with cap 1" above ground level bears South 01° East, 37.4 feet.

A 5/8" x 24" iron rebar with a 1 1/4" yellow plastic cap stamped "OR PLS 1106, WA PLS 17372", with cap 1" above ground level bear North 26 1/2° West, 31.8 feet.

Attached bearing object signs to all rebar accessories.

Attached bearing object sign to fence corner post 0.6' North of brass cap monument.

LOCATION AND COMMENTS: Corner is located at a fence corner with fences East, South and North 27° West.

## OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 829751.65

E = 8717179.86


FIRM: William R. Wells, PLS  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

/5N35G05

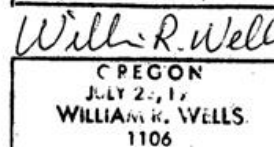

Renews 6/30/06

05-112-C