

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 1N, R 33E., W.M.

Corner Code No. V-13

Notes: Monument marked as shown below

History of original corner establishment:

The most recent original record, by C.E. Redfield, U.S. Indian Service Surveyor, indicates this corner was re-established in 1918 or 1919. Redfield's notes do not state what was set for the corner monument other than a "stake". Redfield's notes were found in the BIA Realty Section vault at the Umatilla Agency.

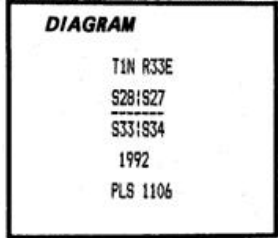

Corner No. Compass Declination: 18.0°

Description of corner evidence found:

None. After a thorough search of the corner area, the corner position was re-established by double proportion measurement using the Redfield record. The nearest recovered corners North, South, East and West of the corner point were used in proportioning. See Survey No. 92-35-B.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2 1/2" brass cap on a 1 1/4" by 30" G.I.P. 31" in ground from which:
A 5/8" by 30" rebar bears N 0° 10' E - 290.00' with a steel fence post set 1' from rebar and a Bearing Object sign attached.
A 5/8" by 30" rebar bears N 52° 38' W - 250.08'. Nailed a Bearing Object sign to wood fence corner post near rebar.
A 5/8" by 30" rebar bears S 89° 42' W - 356.71' with a steel fence post set 1' from rebar and a Bearing Object sign attached.
A 5/8" by 30" rebar bears N 44° E - 30.71' with a steel fence post set 1' from rebar and a Bearing Object sign attached.

All reference corner rebars are capped with a yellow plastic cap marked "W.R. Wells, PLS 1106".
Set a steel fence post 3' North of monument with a Survey Marker sign attached.

REGISTERED PROFESSIONAL LAND SURVEYOR
W.R. Wells
OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
(COUNTY OFFICIAL) by (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
Umatilla County Surveyor
Date
Rec'd By
No. 92-35-B

☆ GPO-788-878