

# OREGON CORNER RESTORATION FORM

Section 36 Township 5S Range 31E  
 County Umatilla Date: 11-28-01

Corner Designation: 5S31Z25

_____	Condition Report Only
_____	Not Found
_____	Re monumented
_____	Unrecorded
_____X_____	Surveyed In
_____	Referenced Out


**Previous Renewals / Surveys, etc.**

Under Special Instructions dated May 6, 1957, James Jelly of the BLM replaced the original stone with a BLM brass cap stamped as shown in the diagram. He set two new bearing trees; A pine, 18 ins. diam., bears N.80 1/2°E., 205 lks. dist. mkd. T5S R32E S31 SC BT. A pine, 28 ins. diam., bears N.22°W., 478 lks. dist. mkd. T5S R31E S36 SC BT.


**Monument and Accessories Found: ( condition and source )**

Found the brass cap as described. Found: a ponderosa pine N80°30'E, 135.3'; found a ponderosa pine N22°W, 315.5'.

**DIAGRAM**

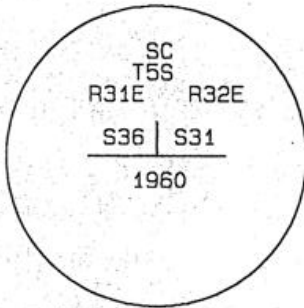

**SKETCH**

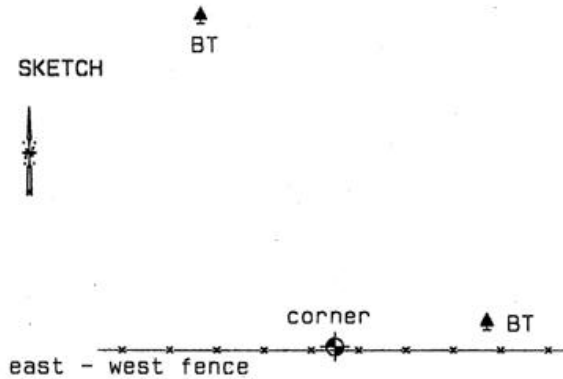

**MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)**

None.

**REFERENCES SET:**

None.

Made GPS tie to TRI Station FORE..	Oregon State Plane Coord. - North Zone
Latitude 45°04'59.94969"N	Northing 520558.16
Longitude 118°54'02.89875"W	Easting 8615115.53
NAD 83(1991)	Ortho Height 4367.44
	Ellipsoidal Height 4308.60

**Location and Comments**

From junction Highways 395 and 244, go east 1 mile on Highway 244; go south on Forest Service Road 52.6 miles to rockpit. Walk north to east-west fence. Follow fence west 500' to corner.

**Compass Declination**  
20°E

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

**RECEIVED BY:**

Date: 01-02  
 Rec'd By: KL  
 No. 02-07-R

**Firm / Agency**

Haddock Surveying  
 P. O. Box 1574  
 Pendleton, OR 97801  
 (541) 276-2174

*David L. Haddock*

OREGON  
JULY 12, 1968  
DAVID L. HADDOCK  
852

RENEWS 6-30-03