


FND. 1 1/2" IRON PIPE 1ST DEEP
NE COR SECTION 1. BRASS CAP
MISSING. SEE KRUMBEIN SURVEY
UMATILLA Co. #I-186-A

N 0° 09' 05" E 770.115

FND. 2 1/2" X 36" I.D. IRON PIPE 1ST DEEP
AT INTERSECTION OF OLD BURIED FENCE
CORNER WITH REMAINS OF 50+ YEAR OLD
BARB WIRE & ROTTEN FENCE POSTS AT 2ND
DEPTH. 2ND ROAD CUT IN THIS AREA HELPED
OUR FIND. CORNER WAS 4TH DEEP WHICH
IS PROBABLY WHY IT WASN'T FND. BEFORE.
SET 5/8" X 30" IRON ROD WITH ALUMINUM CAP
MARKED EAST 1/4 COR. SEC. 12, LS 1861
IN Q OF PIPE.

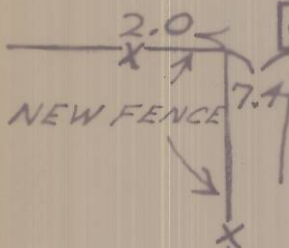

N 0° 11' 46" W

2652.39

S.E. COR SEC. 12
FND. RAILROAD SPIKE
USED BY WILLIAM WELLS
SURVEY DATED 8-20-82
UMATILLA Co. #82-60-B



NARRATIVE

THE PURPOSE OF THIS SURVEY
WAS TO FIND THE EAST 1/4 COR.
OF SECTION 12. THIS WAS DONE
BY USING WILLIAM WELLS SURVEY
#82-60-B & KRUMBEIN SURVEY #I-186A
AS SHOWN ON THIS MAP.
DISTANCES WERE MEAS. WITH AN AGA-76
EDM & ANGLES WITH 6 SECOND THEODOLITE.
BEARING BASE WAS ASSUMING LINE
BETWEEN SE COR SEC. 12 & NE COR SEC.
1 TO BE N 0° 05' E.

86-15-A

- - MONUMENT FND AS NOTED
- - 5/8" X 30" IRON ROD & ALUMINUM CAP SET

R&M SURVEYORS & CONSULTANTS INC.
P.O. BOX 709, IRRIGON, OR. 97844 PH. 922-3093

SURVEY FOR UMATILLA
ELECTRIC IN SEC 12
T.2N., R.33E. W.M.
UMATILLA CO.

DATE: 10-6-85

DRWN. BY EDM

SCALE: 1" = 400'

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Earl D. Ming

OREGON
1911

RECEIVED BY
Umatilla County Surveyor
Date 2-12-86
Rec'd By KA
No. 86-15-A