


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

P-11  
340340  
T. 1 N., R. 36 E.  
C 1/4 corner of section 21

**History of original corner establishment:**

1997-99, Kaiser, Griffin and Seibold, BLM Cadastral Surveyors, established the corner as follows:  
Point for the center 1/4 sec. cor. of sec. 21, at intersection with the E. and W. center line.  
Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, in a collar of stone, with brass cap, from which:  
A ponderosa pine, 32 ins. diam. bears N. 60° E., 35 lks. dist., mkd. C 1/4 S21 BT.  
A ponderosa pine, 27 ins. diam. bears S. 35 3/4° W., 85 lks. dist., mkd. X BT at the base.  
Deposit a magnet in a white plastic case at the base of the stainless steel post.

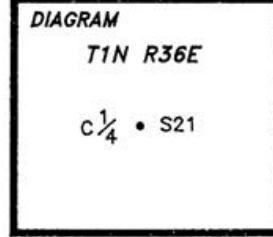

2000, David L. Haddock, Registered Land Surveyor 852, while surveying in sections 21 and 22 for the Umatilla N.F., Found the standard BLM brass capped monument in good shape as described. Both bearing trees were found in good shape also. Marked New BT's:  
20" Douglas Fir bears S. 22° E., 15.1 feet scribed C 1/4 S21 BT.  
24" Douglas Fir bears N. 20 3/4° W., 36.9 feet scribed C 1/4 S21 BT.  
After marking the new bearing trees Haddock finds evidence of the original 1/4 corner of sections 16 & 21, and the original 1/4 corner of sections 21 & 22, making the BLM monument an erroneously established corner. Haddock reports this discovery to the Forest Service which instructs him that they will report the revisions to the county after the BLM corrects their survey.

2001, Richard S. Kaiser, BLM Cadastral Surveyor, corrects the BLM's corner as follows:  
Point for the center 1/4 sec. cor. of sec. 21. From this point, the center 1/4 sec. cor. of sec. 21, erroneously established by Kaiser, Griffin, and Seibold in 1997-99, bears N. 16°10'31" W., 36.44 ft. dist.; monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above the ground, in a collar of stone, with brass cap mkd. and witnessed as described in the official record. I obliterate the marks on the SW. bearing tree.  
Remove the stainless steel post and magnet and at the true corner point  
Reset the stainless steel post, 28 ins. long, 2 1/2 ins. diam., 18 ins. in the ground, in a mound of stone, 3 1/2 ft. base, to top, with brass cap  
from which a bearing tree mkd. by Kaiser, Griffin, and Seibold  
A ponderosa pine, 32 ins. diam., bears N. 12° E., 47.6 ft. dist., with scribe marks C1/4 S21 BT visible on partially healed blaze.  
and a new bearing tree  
A Douglas fir, 18 ins. diam., bears S. 57 3/4° W., 9.0 ft. dist., mkd. C1/4 S21 BT  
Deposit a magnet in a white plastic case at the base of the stainless steel post.  
Corner is located 35 ft. N. of gulch, drains SW.

**Description of corner evidence found:**

Found a 2 1/2" diameter stainless steel pipe, with 3 1/4" diameter brass cap, projecting 4" out of the ground, surrounded by a ring of stones, marked as shown, from which:  
34" Ponderosa Pine bears N 12° E, 46.5 feet, with scribing visible on pitched over blaze.  
18" Douglas Fir bears S 56 1/2° W, 9.0 feet, with scribing visible on an unhealed blaze.



In addition I also find 2 trees marked by Haddock to reference the corner erroneously established by the BLM in 1977-79. I obliterate the marks on these trees.

**Description of monument and accessories I established to perpetuate the original location of this corner:**

**New References:**  
19" Douglas Fir bears S 1 1/4° E, 58.6 feet, scribed "C1/4 S21" "BT".  
21" Douglas Fir bears N 10 1/4° W, 19.6 feet, scribed "C1/4 S21" "BT".  
The new bearing trees are double blazed and have a 3/4" diameter brass washer stamped "RLS 2308" nailed to the lower blaze between the scribed "B T".

DATUM: NAD83(1991) Oregon High Accuracy Reference Network  
STATE PLANE COORDINATES: Oregon North Zone in International Feet  
No. Latitude Longitude Northing(Y) Easting(X)  
340340 45°33'04.52537" N. 118°19'05.74664" W. 694621.581' 8760927.432'

Work Performed By: David A. Schlaich (RLS 2308)  
Witnessed By: Matthew Duffy  
Equipment: Topcon GPT-6005C Total Station  
Magnetic Declination: 17 1/2° East  
Date: August 20, 2002

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*David A. Schlaich*

OREGON  
JULY 16, 1987  
DAVID A. SCHLAICH  
2308

RENEWAL DATE: 06/30/2004

Office of..... County of.....  
State of....., I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 20.....  
..... by..... (DEPUTY)  
(COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

SEE MAP OF SURVEY NO. D3-31-B