


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N, R 32E., W.M.

Corner Code No. E-25
Note: Monument marked as shown below

History of original corner establishment:

Contract No. 106, surveyed in 1864, states that a wood post was set to monument the corner with several cottonwood bearing trees as accessories.
Contract No. 145, which superceded Contract No. 106, stated that the corner was monumented with a wood post.
County Survey No. 11, in 1881, shows that the corner point was recovered.
Special Instructions and Contract dated 1887, shows that the corner point was recovered and re-monumented with a wood post.
Map of John Kjabrell surveys on Page 310, in Record of Private Surveys Book No. 1 in the County Surveyor's Office, indicates that the corner was recovered by Kjabrell prior to 1895.
In 1917, L.E. Wilkes, under Group 29 Instructions, did a resurvey of the diminished Umatilla Indian Reservation Boundary, declared this corner lost and reestablished the corner and monumented it with a 2" diameter by 3' long iron post with brass cap.
Recent survey maps in the county record indicate that an iron pipe with brass cap exists for the corner monument.

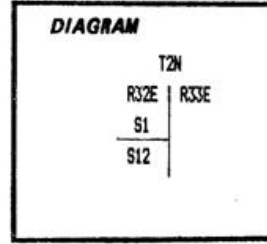

Corner No.
Compass Declination: 18.0

Description of corner evidence found:

Found a 2 1/2" rounded brass cap on 2" iron pipe protruding 8" from the ground at a fence corner with fences going east and north. The monument is located just south of the railroad tie fence corner post. The brass cap is marked as shown on the corner diagram.

Note: This monument is of different construction from those normally used by L.E. Wilkes on his 1917 survey. One recently recorded survey map indicated that the monument was placed by the Bureau of Reclamation. No record was found showing the monument being placed by the Bureau of Reclamation.

Description of monument and accessories established to perpetuate the original location of this corner:

Referenced the corner monument as follows. From the corner monument:
The southeast corner of the concrete on a 8 by 12 foot concrete slab bears S77°W 15.5. A pig pen is now constructed on the concrete slab.
An aluminum nail in the west side of PP&L Pole No. 070900 bears N8°W 4.1'.
An aluminum nail in the south side of a wooden brace post in an east-west fence bears East 19.81.
The aluminum nails mentioned above are about 1' above the ground.
A witness corner sign was placed on the railroad tie fence corner post north of the corner monument. The corner monument is protected by this fence corner.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of..... County of.....
State of..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)