

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

E-25

History of original corner establishment:

Corner established by George S. Pershin, U.S. Deputy Surveyor, under his Contract No. 304 and dated September 19, 1878.


Surveyor General records state:

Set basalt stone 20x10x5 and drove stake on S.W. face of spur for corner to Sections 1, 12, 6 & 7. Raised mound of stone around stone and stake in lew of pits.

Corner remonumented by Robert F. Omeg, U.S. Deputy Surveyor, under his Contract No. 761, dated June 16, 1905.

Surveyor General records state:

Set a basalt stone 20x10x5 ins. in a mound of stone on stony ground for cor. of secs. 1, 6, 7 and 12 marked with 1 notch on the N and 5 notches on the S edge; and raised a mound of stone 2 ft base and 1 ft and a half high W of the corner.

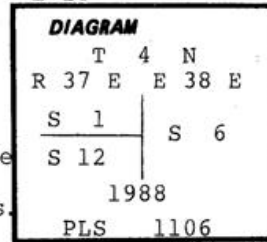

Description of corner evidence found:

No trace of original monumentations.

This corner was searched for a total of 2 1/2 hours with a 2 person crew without success. The original corner stone has undoubtedly slid down the hill from snow and rock slides.

Description of monument and accessories established to perpetuate the original location of this corner:

Corner was re-established by modified single proportion measure as described in section 5-36 of the 1973 "Manual". Corners used for control were the found East 1/4 corner of Sec. 12, T4NR37E, and the found East 1/4 corner of Sec. 1, T4NR37E. Since corner falls on a fractured basalt outcrop on a very steep West slope, a conventional monument is impractical. Instead, at the corner point determined by survey...

Set a 5/8" x 22" iron pin driven into rock and surrounded with mortar. The 5/8" iron pin has a 1 1/2" aluminum cap, marked as shown in corner diagram.

No trees are within limits so I marked 2 bearing objects to reference the corner as follows: A 2'x1'x1' out of ground rock in place brs N49 1/2° W, 12.5' marked "XBO" on SE face. This rock in place is at the N edge of the same rock outcrop the corner is on. A 10"x10"x6" out of ground rock in place brs S48 1/2° W, 6.7' marked "XBO" on surface facing Northeast.

Painted bearing objects and rocks around corner red.

Set 6' steel fence post North of corner 24.7' to avoid the rock outcrop and attached sign 54-4.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly re-established by me on September 1, 1988.

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of County Surveyor County of Umatilla
 State of Oregon I hereby certify that the within instrument was filed in this office
 for record on the 17th day of October, 1988
David H. Kumbier by Kathleen K. Ambrose
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor
 Date 10-88
 Rec'd by KA
 No. 88-64-B

*GPO-591-971, 1988