

OREGON CORNER RESTORATION FORM

Section: 3, 10 Township: 3N Range: 33E
 County: Umatilla Date: 10/6/2011

Corner Designation: 3N33E15

Quarter corner common to Sections 3, 10, T3NR33E.

Condition Report Only	
X	Not Found
X	Remonumented
X	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth with charred stake and pits.

Monuments and Accessories Found: (Condition and Source):

None.

Diagram

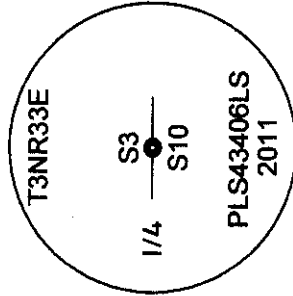

Sketch

ORANGE
MAGNET ●

SILVER
MAGNET ●

FIELD LINES

BC

● PINK
MAGNET

NAD 83/91
 OREGON STATE PLANE NORTH
 INTERNATIONAL FEET

● BLUE
MAGNET

N768900.18
 E8668325.21

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.5' below the surface. The corner location was reestablished using single proportionate method. This fits with existing field lines.

References Set:

- "Deep One" magnets by Berntsen.
- An orange magnet lies N 31° 10' W, 32.98' 1.6' deep.
- A silver magnet lies N 30° 15' E, 32.24', 1.5' deep.
- A pink magnet lies S 40° E, 25.03', 1.6' deep.
- A blue magnet lies S 53° 50' W, 40.94', 1.6' deep.

Location and Comments:

The corner is located 1/2 mile West of the intersection of Enbysk Rd. and Deining Rd.

Compass Declination

17° E

Surveyors Seal

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Robert D. English

OREGON
 JANUARY 11, 2005
 ROBERT DOUGLAS ENGLISH
 43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:**Firm / Agency**

Survey One, LLC.
 P.O. Box 382
 Pendleton, OR 97801
 (541) 276-2055

Date: 7/10/2012
 Rec'd By: [Signature]
 No. 12-094-e