


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established in September 1832 by U.S. Deputy Surveyor.

Surveyor General Record States:

Set a post 4' long and 4" square 24" in ground raised a mound of stones around post from which:

- a fir 8" in diameter bears N.45°E. 24 lks. distance marked T.1N., R36E., Sec. 33 B.T.
- A Tamarack 14" diameter bears N55°W. 33 lks. distance marked T 1N., R36E. Sec. 32 B.T.

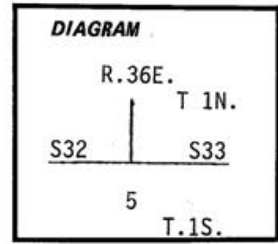

Z-9

Description of corner evidence found: No evidence of the original corner was found other than the two B.T.s.

- a 14" white fir is badly rotted with top broken off 12' from the ground. Scribing visible but not legible on S.W. face.
- a 14" Tamarack blown down long ago with scribing legible T 1N., R36E., Sec. 32

Description of monument and accessories established to perpetuate the original location of this corner:

At a point 24 links distance and which bears N45° E. to center of old rotted fir B.T. I set a 2 1/2" X 30" iron pipe with brass cap, marked as shown, 25" in ground and placed a mound of stones around it. I established three new B.T.s.

- a 25" white fir bears N.69°W., 22.0 feet, is marked T. 1N., R. 36E., Sec. 32. B.T.
- a 12" white fir bears N. 28° E., 33.0 feet, is marked T 1N., R36E., Sec. 33. B.T.
- a 14" white fir bears S.21°W., 40.2 feet is marked T. 1S., R.36E., Sec. 5 B.T.

Measurements to the center of trees with a steel tape and magnetic compass with 20° East declination.



Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

