

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 02/21/06

CORNER DESIGNATION: 3N31, V-5, The Southeast One-Quarter Corner of Section 30.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by D.S. Payne, under Contract No. 100, dated August 1, 1861. Record states: Set charred stake with mound, trench and pits as per insts. for corner to Secs. 29, 30, 31, & 32. State Highway Department freeway right-of-way and monumentation maps for Interstate 84 show a State Plane coordinate (NAD 27) for this corner.

MONUMENT AND ACCESSORIES FOUND:

Held the intersection of an old East-West fence and a field berm with fence wire and rock jacks South as best remaining evidence of the original corner. I attempted to hold indexed state highway map coordinate to re-establish this corner, but its position falls in a CRP field Northeast of the old fence intersection held.

MONUMENT MARKING DETAIL:

T3N R31E
S30|S29
S31|S32
2006
PLS 1106

MONUMENT SET:

At the intersection of the old fence, set a 2 3/8" brass cap on 1 1/4" x 30" galvanized iron pipe with top 2" above ground level and surround with mound of earth and two stones. Set a steel fence post with witness sign 1 foot South of monument.

From which:

A 5/8" x 24" iron rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106, WA PLS 17372", bears South 06 1/2° East, 34.1 feet.

A 5/8" x 24" iron rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106, WA PLS 17372", bears South 89° East, 28.4 feet.

A 5/8" x 24" iron rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106, WA PLS 17372", bears South 57° West, 51.8 feet.

A 5/8" x 24" iron rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106, WA PLS 17372" bears North 88° West, 35.8 feet.

Attached bearing object signs to all rebar accessories.

LOCATION AND COMMENTS: Corner is located in a East-West fence in scab ground approximately 300' South of I-84. A old fence line extends South.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 746658.93
E = 8591791.22


FIRM: William R. Wells, PLS
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Witnesses: Jason Wells, LSIT

/3N31V5

Surveyor's Seal

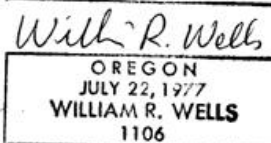

06-462-c