

OREGON CORNER RESTORATION FORM

Section: 13, 18 Township: 3N Range: 32E, 33E
County: Umatilla Date: 3/9/2011

Corner Designation: 3N33L01 (Amended 3/13/2012)

Quarter corner common to Sections 13, T3NR32E; 18, T3NR33E.

	Condition Report Only
X	Not Found
X	Remonumented
	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Thompson in 1864. He set a post in a mound of earth.


Monuments and Accessories Found: (Condition and Source):

None.

Diagram

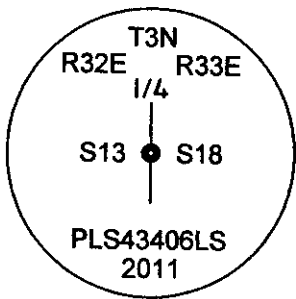

Sketch

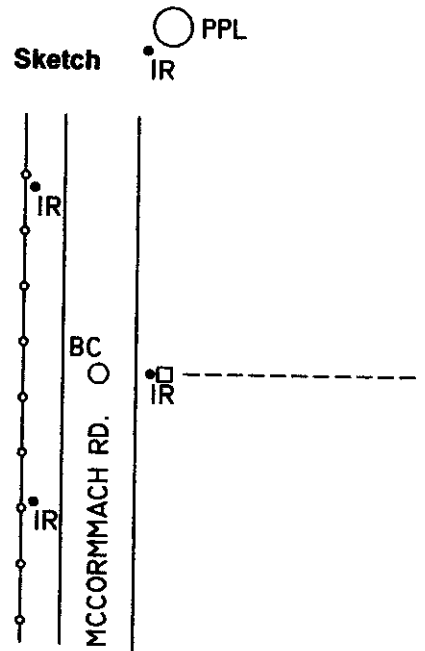

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N760660.08
E8650043.60

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with a 2 1/2" brass cap, stamped as shown above, 1.2' below the surface, at the intersection of a field line from the East and the North-South line held between found corners.

References Set:

- A 5/8" x 30" iron rebar w/RPC #43406 lies N 30° W, 21.35'.
- A 5/8" x 30" iron rebar w/RPC #43406 lies N 8° 40' E, 147.43'.
- A 5/8" x 30" iron rebar w/RPC #43406 lies East, 24.69'.
- A 5/8" x 30" iron rebar w/RPC #43406 lies S 38° 45' W, 16.44'.

Location and Comments:

The corner is in McCormmach Rd. 1/2 mile North of the intersection of Fulton Rd. and McCormmach Rd.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert Douglas English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Firm / Agency

Date: 7/10/2012
Rec'd By: [Signature]
No. 12-094-C

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/13