

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 3N, R 33E., W.M.

Corner Code No. J-19

Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by David Chaplin, U.S. Deputy Surveyor, under Contract No. 107, dated August 21, 1864. The original notes state that at the corner a wood post, with charred stake, earth mound and pits was established for the corner.

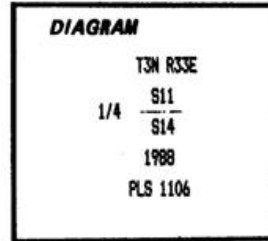

Corner No.
Compass Declination: 18.0

Description of corner evidence found:

Intersection of State Highway No. 335 (extending north-south), and County road (new road number 974), extending west from State Highway.

Description of monument and accessories established to perpetuate the original location of this corner:

Reestablished the corner point at the intersection of State Highway No. 335 and a County Road (new road no. 974) which runs west from State Highway No. 335. This position was verified by measurements to found reestablished corners to the west of the corner point, (See recorded survey map).

At the reestablished corner point I set a 2 1/2" brass cap on a 1 1/2" by 16" galv. iron pipe, in a monument box consisting of a 15" pvc pipe sleeve and monument access cover, in the pavement of State Highway No. 335, and surrounded the monument with mortar.

Referenced the monument as follows. From the new monument:

The top centerline of a PNB phone pedestal bears S39°E 39.3'.

An aluminum nail in the NW side of BPA pole no. PT ST 32 5, bears S45°W 36.96'. The aluminum nail is about 1' above ground. Attached witness corner and bearing object signs to the pole.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of *Survey* Dept. County of *Washtenaw*
State of *Michigan*, I hereby certify that the within instrument was filed in this office
for record on the *6th* day of *May*, 19*88*
David W. Kumbria by *William R. Wells*
(COUNTY OFFICIAL) (DEPUTY)

88-17B