

OREGON CORNER RESTORATION FORM

Section: 26, 27
County: Umatilla

Township: 3N
Date: 10/7/2011

Range: 33E

Corner Designation: 3N33T17

Quarter corner common to Sections 26, 27, T3NR33E.

	Condition Report Only
X	Not Found
X	Remonumented
	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth with charred stake and pits.
In 1871 Moody set a post and made a mound of earth.
In 1887 Currin and Noland deposited a charred stake and raised a mound of earth.

Monuments and Accessories Found: (Condition and Source):

None.


Diagram

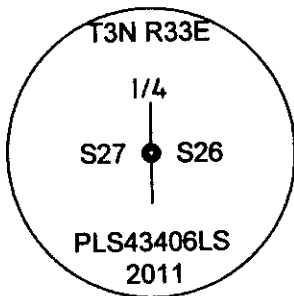

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N750555.10
E8671377.42

Sketch

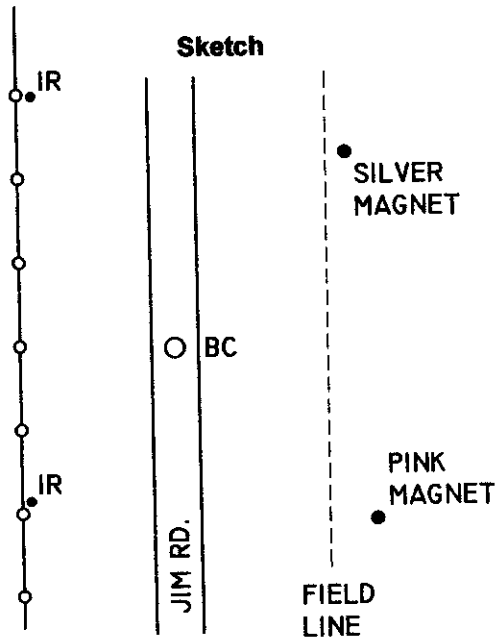

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.3' below the surface. The corner location was reestablished by using the single proportionate method between found monuments to the North and South and by holding the centerline of Jim Rd.

References Set:

"Deep One" magnets by Berntsen.
A 5/8" x 30" iron rebar w/RPC #43406 lies N 28° W, 29.91', at a fence post.
A silver magnet lies N 42° 20' E, 27.27', 1.4' deep.
A pink magnet lies S 48° 20' E, 27.65', 1.4' deep.
A 5/8" x 30" iron rebar w/RPC #43406 lies S 44° 30' W, 21.90', at a fence post.

Location and Comments:

The corner is located 1/10 mile, M/L, South of the intersection of Hwy. 11 and Jim Rd.

Compass Declination
17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 7/10/2012
Rec'd By: S. Ores
No. 12-094-C

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/13