

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established by George S. Pershin under G.L.O. contract number 340 dated Sept., 26, 1879.

Surveyor General's records state:

Set a fir post on SW slope for 1/4 sec cor from which:

- A fir 12" diam. bears N 17° E., 27 lks. dist. marked 1/4 S BT
- A fir 12" diam. bears N 50° W., 6 lks. dist. marked 1/4 S BT

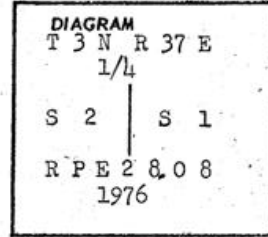

C-21

Description of corner evidence found:

- A fir 36" diam. bears N 17° E., 17.82 ft. (27 lks) dist. with letter S visible inside 6" overgrowth.
- A fir snag 30" diam. bears N 50° W., 3.96 ft. (6 lks) dist. with visible axe marks inside 3" overgrowth.

Description of monument and accessories established to perpetuate the original location of this corner

Set a 2 1/2" brass cap on a 2" iron pipe 31" long 4" above the ground with a 6' steel fence post 3' south with sign 54-4 attached.

new bearing trees:

A larch 10" diam. bears N 08° W., 43.5 ft. dist. marked 1/4 S 2 ET with sign 54-3 attached 6" below a band of red paint and has a brass washer marked RPE 2808 nailed flush with ET blaze.

Painted sec 1 ET with red paint and attached sign 54-3.



Office of Surveyor..... County of Umatilla
 State of Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the 26 day of August, 1976
 by
 (COUNTY OFFICIAL) (DEPUTY)