

# CORNER RESTORATION FORM

Township 4N Range 28E Section 9.16 County UMATILLA  
 State OREGON Date 5-23-2019 Number J-11

Corner Designation: 9.16

Previous Renewals: ORIGINAL SOURCE OF CORNER

ORIGINALLY SURVEYED IN 1860 BY HAFT UNDER CONTRACT #93. HE SET POST IN

MOUND WITH TRENCH, MADE PITS AND DEPOSITED A PINT OF CHARCOAL.

Accessories Found: \_\_\_\_\_

FOUND RAILROAD SPIKE AT AC GRADE, N84°46'E 1.72'.


Condition Report Only  
 Not Found  
 Renewed  
 Surveyed In  
 Referenced

### MONUMENT DETAIL

Found  Set

BASIS OF BEARINGS, NAD 83/91 OREGON STATE PLANE  
 COORDINATES NORTH ZONE:

NORTHING: 792827.71  
 EASTING: 8502493.39

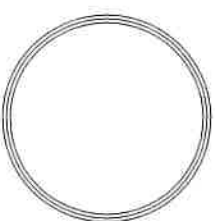

Monument & Accessories Set (Procedure and Description) \_\_\_\_\_

- FOUND 5/8" IRON REBAR, NO CAP, AS PER COUNTY SURVEY 10-118-A.
- SET 5/8" x 10" IRON REBAR w/RED PLASTIC CAP MARKED PLS 61420, 1' SOUTH OF POWER POLE, 1' BELOW GRADE, N69°00'W 81.96'.
- SET 5/8" x 10" IRON REBAR w/RED PLASTIC CAP MARKED PLS 61420, 1' SOUTH OF SIGN, 1' BELOW GRADE, N86°10'E 172.86'.
- SET MAG NAIL, 1' NORTH OF SOUTH EDGE AC, WALKING PATH, S48°15'E, 64.32'.
- SET MAG NAIL, 1' SOUTH OF NORTH EDGE AC, WALKING PATH, S66°26'W, 82.64'.

Sketch of Monument, Accessories and General Area

**REGISTERED  
PROFESSIONAL  
LAND SURVEYOR**

*Lance Clark King*

**OREGON**  
MAY 10, 2011  
LANCE CLARK KING  
61420

**RENEWALS: 6/30/2021**

Agency: CK3, LLC  
 945 W. ORCHARD  
 HERMISTON OREGON 97838  
 OFFICE: 541-567-2345  
 FAX: 541-567-2305  
 WEB: CK3LLC.NET  
 Field Book # 0-325

**COUNTY SURVEYOR  
RECORDING INFO**

Received \_\_\_\_\_

Filed \_\_\_\_\_

Survey No. \_\_\_\_\_

Drawing No. \_\_\_\_\_

Index No. J-11

19-080-C