

OREGON CORNER RESTORATION FORM

Section 24 Township 4N Range 30E

County UMATILLA Date 5/26/04

CORNER DESIGNATION

R-25
(SOUTHEAST CORNER)

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- X Surveyed In
- X Referenced Out


Previous Renewals/Surveys, etc.:

DAVID THOMPSON, UNDER CONTRACT NO. 81, DATED JULY 8, 1859, SET POST BUILT MOUND OF EARTH WITH PITS, TRENCH, ETC.

Monument(s) & Accessories Found: (Condition and Source)

NONE

Monument Detail

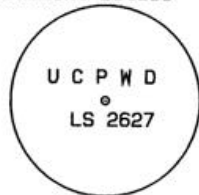

Monument Set (Procedures and Description):

SET A 5/8" X 30" IRON REBAR WITH YELLOW PLASTIC CAP MARKED AS SHOWN AT THE INTERSECTION OF AN OLD EAST-WEST FENCE TO THE WEST AND AN OLD FENCE AND PLOW LINE SOUTH OF THE BROW OF THE HILL TO THE SOUTH. MONUMENT IS APPROXIMATELY 4" BELOW THE GRAVEL SURFACE OF THE ROAD.

New Accessories:

- A 5/8" IRON REBAR WITH YELLOW PLASTIC CAP MARKED "UCPWD...LS2627" BEARS S87°21'03"W, 11.24'.
- A 5/8" IRON REBAR WITH YELLOW PLASTIC CAP MARKED "UCPWD...LS2627" BEARS N49°46'47"E, 38.58'.
- A 5/8" IRON REBAR WITH YELLOW PLASTIC CAP MARKED "UCPWD...LS2627" BEARS S59°00'50"E, 34.66'.
- A 5/8" IRON REBAR WITH YELLOW PLASTIC CAP MARKED "UCPWD...LS2627" BEARS S40°22'42"W, 32.76'.

Location and Comments: Compass Declination: N/A

Surveyor's Seal

CORNER IS LOCATED 4" BELOW THE GRAVEL SURFACE OF TERNEY ROAD, APPROX. 180 FEET NORTH OF THE CENTER OF DESPAIN GULCH ROAD.

Firm/Agency :
UMATILLA COUNTY
ROAD DEPARTMENT

Address:
3920 WESTGATE
PENDLETON, OREGON

Party Chief:
GARY ROBERTS
Notes:
GARY ROBERTS
Witness:
NONE

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Gary R. Roberts
OREGON
JULY 20, 1993
GARY R. ROBERTS
2627

RENEWS 12/31/2004

