

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 07/10/13

CORNER DESIGNATION: 3N32, A13, The Northwest Corner of Section 3.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Thompson, under GLO Contract 106, dated August 1864, notes state: Set post for corner to Secs. 3, 4, 33, 34 in mound of Earth with charred stake, pits, trench, &c as per instructions. In Umatilla County Survey No. 88-18-B, William Wells held the intersection of the South Cold Springs Road and a fence line extending South as evidence of the corner position.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T4N R32E
S33|S34
S4 | S3
T3N
2013
PLS 54657

MONUMENT SET: The fence extending South is now removed. I reestablished the position determined on Survey No. 88-18-B from ties to said survey and held the position as the best remaining evidence of the original corner position. At the reestablished corner point, set a 5/8" x 24" rebar with 2" aluminum cap, 1" below asphalt, stamped as stated in "Monument Marking Detail", from which:

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54756" bears North 47 1/2 ° East, 42.0 feet.

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54756" bears South 54 ° East, 36.7 feet.

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54756" bears South 10 ° West, 22.0 feet.

A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54756" bears North 46 ° West, 34.9 feet.

Attached bearing object signs to all accessories.

LOCATION AND COMMENTS: Located in South Cold Springs Road.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N= 773538.13'

E= 8633877.85'

FIRM: Wells Surveying

P.O. Box 1696

Pendleton, OR 97801


COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS

Dean Roy

\3N32A13

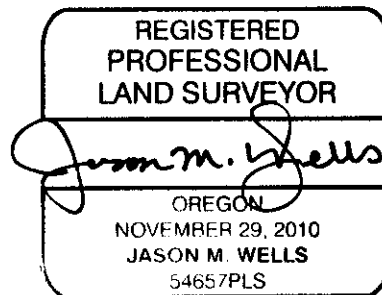

RENEWS: 6-30-14