


REGISTERED RECORD OF LAND CORNER MONUMENTATION

T 4N, R 36E., W.M.

Corner Code No. T-9
Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by William Odell, U.S. Deputy Surveyor, under Contract No. 118, dated July 2, 1866. The original notes state that at the corner a wood post was set from which:
A 3 1/2" pine bears S80°W 90 lks.
A 7" pine bears S70°E 94 lks.

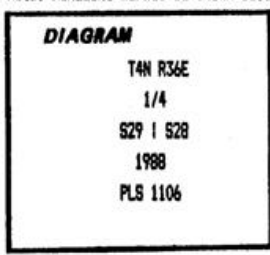

Corner No.
Compass Declination: 19.0°

Description of corner evidence found:

A sawn, rotted 36" ponderosa pine stump, with scribes "BT" visible on lower blaze bears S80°W 59.4'.

Description of monument and accessories established to perpetuate the original location of this corner:

Reestablished corner position at a point N80°E 59.4 feet from the found bearing tree stump and set a 2 1/2" brass cap on 1 1/2" by 30" galv. iron pipe 24" in the ground and surrounded with a mound of earth. From the new monument:

- A 16" ponderosa pine bears N62°E 21.3' scribed 1/4 S28 BT.
- A 11" ponderosa pine bears S56°W 85.2' scribed 1/4 S29 BT.
- A fence corner with fences running east-west and north bears N10°W 7'.

Attached bearing object signs to the new bearing trees and the original bearing tree stump. Placed a steel fence post north of corner and attached witness corner sign.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

7-27-88

Office of Survey County of Umatilla
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 28th day of July, 1988
David H. Lumbert by Kathleen Amberg
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
Umatilla County Surveyor ⁸⁰⁰⁻⁷⁹⁸⁻⁵⁷⁴
Date 7-88
Rec'd by NA
No. 88-42-C