

USDA-FOREST SERVICE

Index
 File No. J-12
 T 4S R. 32E
 Merid. Willamette

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or Survey No. Sec 9 Cor. No. E 1/16

R.D. Ukiah County Umatilla
 N.F. Umatilla State Oregon

CORNER DIAGRAM

T4S R32E



S9
 ———— E 1/16
 S16

DESCRIBE CORNER MONUMENT FOUND

Found 2" GIP w/ 2 1/2" B.C. PLS 1051 1977
 MOS

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

Fir 10" dia., Brs N 8° 58' E 30.5 FT
 Fir 10" dia., Brs S 20° 44' E 19.5 FT

PHOTO IDENTIFICATION DATA

Photo No. _____
 Filed At. _____
 Object Ident. _____
 Ident. By _____
 Signature _____

PLANE COORDINATE POSITION DATA

State _____ Zone _____
 X _____
 Y _____
 Estab. By _____
 Agency _____

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

INTERSECTION Rd 5417 And 5417-020; SOUTH
 Rd 5417-020 1/2 mi TO SOUTH LINE SEC 9;
 DUE EAST 450' E 1/16 SEC 9
 16

Signature Ant E Weaver Title P.L.S. Division _____ Headquarters _____ Date 12/11/80
 7100-52-(3,68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

Work Done By K.C. Weaver Title PLS Date 12/11/80 State Registration No. 1679
or Agency

Certified Cor. Record Prepared ? Yes No Filed At: _____ Date _____

REMARKS

Index File No. T. R. M. Tract or Surv. No. Cor.

USDA-FOREST SERVICE

Index
File No. J-12
T 4S R. 32E
Merid. W.M.


CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

R.D. Ukiah County Umatilla
N.F. Umatilla State Oregon

Tract or
Survey No. _____
Cor. No. E1/16

CORNER DIAGRAM

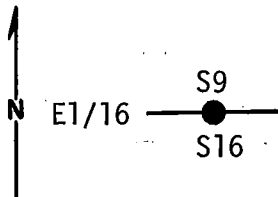

DESCRIBE CORNER MONUMENT FOUND

None Set.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

None Set.

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____

Signature

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____

Agency

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

The corner lies on a steep easterly slope about 20 feet south of east-west fence.

Signature

Barney B. Barlow

Title
P.L.S.

Division

Headquarters

Date

11/8/77

7100-52-(3/68)

CORNER RECORD (PERPETUATION)

GPO 902-673

MONUMENT : DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Set 2½"x30" galvanized pipe with brass cap marked:
Set pipe 26" in ground and built a mound of stone to the cap.

14S R32E
S 9
E1/16 ———
S16
1977
OR PLS 1051

9

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

A Fir 8" in dia. bears N17°E, 20.5 ft., scribed E1/16 S9 BT.
A Fir 9" in dia. bears S14°E, 19.5 ft., scribed E1/16 S16 BT.
Attached brass washer, stamped PLS 1051, to the foot blaze of each BT.
Attached a 54-3 and a 54-4 sign to each BT.
Set a painted metal fence post 3 ft. north of monument with a 54-2 and 54-4 sign attached.
Set another post 3 ft. west of monument with a 54-2 and a 54-9 sign attached.
Painted a 6" band around each BT and both blazes on each BT red.

10

Work Done By R. C. Orton Title Party Chief Date 11/8/77 State Registration No.
or Agency

Certified Cor. Record Prepared ? Yes No Filed At: Date

11

REMARKS

Witnesses: G. Wagoner
L. Clemens

12

Index File No. T. R. M. Tract or Surv. No. Cor.

13