


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

History of original corner establishment:

None

Index No. R-2

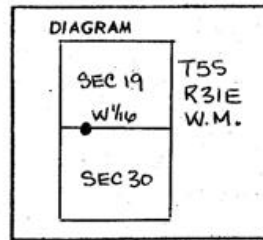

No record of subsequent remonumentation found in County Records .  
Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 15 inches in the ground and surrounded with a mound of stones to the cap .  
Set steel fence posts on property line North of corner and attached signs 54-2 and 54-9.  
Established 2 new BT's: A 7" red fir bears S8° E 17.9 ft. scribed W 1/16 S 30 BT.  
A 8" Tamarack bears N80°W 15.9 ft. scribed W 1/16 S 19 BT .  
BT's have lower blaze scribed BT with a brass washer stamped PLS 1106 nailed to it.  
BT's have 54-3 and 54-4 signs attached and a 6" red band painted around them above blaze.


Used steel tape and magnetic compass with 19 1/2° east declination . Measured to center of Bts.  
See map of survey

This corner set August 12, 1979

Witnesses: Greg Flowers L.S.I.T.  
Brent Reynolds

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*  
OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

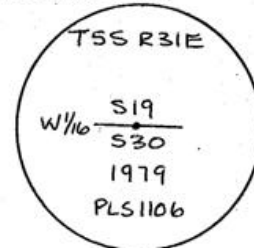

Office of County Surveyor County of Umatilla  
State of Oregon , I hereby certify that the within instrument was filed in this office  
for record on the ..... day of .....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)

**RECEIVED BY**

**Umatilla County Surveyor**  
Date Sept 4, 1979  
Rec'd By M. Hughes  
No. Q-1164-B

Form RG-7100-57 (9/71)  
NOTE: This corner was erroneously established in 7/79 and bearing trees established. When the corner was established in its true position, scribing and signs were removed from the BT's referencing the erroneous position. From the correct corner positions: A 11" red fir bears N83°E 117.7 feet with open blaze. A 9 1/2" red fir bears East 96.5 feet with open blaze.