

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 9/07/95

CORNER DESIGNATION: G-13. West 1/4 corner Section 10, T1S., R34E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Corner originally established by James P. Currin and James E. Noland, under Special Contract, dated May 4, 1887.

Surveyor General records state:

Set post, 3 ft. long, 3 ins. sq., 24 ins. in ground, marked 1/4 S. on W. face, for 1/4 Sec. Cor., from which,

A pine, 14 ins. diam., brs. S. 85° E., 23 lks. dist., marked 1/4 S., B.T., also

A pine, 12 ins. diam., brs. N. 20° W., 16 lks. dist. marked 1/4 S., B.T.

MONUMENT AND ACCESSORIES FOUND: A rotten 30 in. stump with illegible timber cruiser's tag for Section 9 bearing tree.

Note: The tree lying along side stump and the stump itself has barbed wire imbedded 3 ins. into the wood for old fencing. There is evidence of old "face", but tree is burned and no scribing is discernible. It was typical for the early landowners to use bearing trees for fence anchors and that evidence combined with the location of the tree relative to County Road supports acceptance of it for the Section 9 bearing tree.

MONUMENT MARKING DETAIL:

T1S R34E  
1/4  
S9 | S10  
1995  
ORLS 1106

MONUMENT SET: At the position established by the reversed record bearing and distance (S 20° E., 16 lks - 10.6 feet) from the recovered tree stump accepted as the original Section 9 bearing tree, set a 2 1/2" brass cap on a 1 1/2 in. x 30 in. galvanized iron pipe, projecting 6 in. with a 2 foot diameter mound of stone (marked as shown in the monument detail).

From which:

A 30 inch rotten stump bears N 20° W, 10.6 feet (16 lks) per record.

New bearing trees:

A 4 inch ponderosa pine with double blaze scribed "X BT" bears N 67° E., 41.6 feet.

A 10 inch ponderosa pine with double blaze scribed "1/4 S10 BT" bears S 48° E, 47.0 feet.

An 8 inch ponderosa pine with double blaze scribed "1/4 S9 BT" bears S 84° W, 30.9 feet.

A 4 inch ponderosa pine with double blaze scribed "X BT" bears N 60° W, 58.3 feet.

A 1/2" brass washer stamped "PLS 1106" was nailed to lower blaze of each bearing tree. Set a steel fence post near corner monument with witness corner sign attached.


LOCATION & COMMENTS: Corner falls 20 feet Northwest of a right angle curve in County Road.

COMPASS DECLINATION: 18° East.

Surveyor's Seal

FIRM/AGENCY: William R. Wells, PLS  
P.O. Box 1696  
Pendleton, Oregon 97801

Witness: William L. Hanley, PLS  
Rod Lewis, LSIT

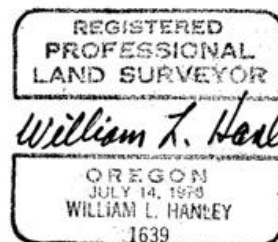

RECEIVED BY  
Umatilla County Surveyor  
Date 10-95  
Rec'd By KK  
No. 95-170-B