


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by Jacob C. Cooper under GLO contract number 397, dated July 1, 1881. Surveyor General record states: Set post 3 1/2 ft long 3 ins square 15 ins in the ground on the N side of ravine 20 ft above spring branch in dense timber for 1/4 sec. cor. marked 1/4 S on E and W faces from which; A tamarack 14 ins diam bears S24°W 5 lks dist marked 1/4 S BT A spruce 8 ins diam bears S10°E 16 lks dist marked 1/4 S BT Range line resurveyed by Henry Meldrum under GLO contract number 450, dated June 11, 1882. Surveyor General record states: As the corners on the West boundary of this Township are not suitable for survey of T1S R37E. . . I am therefore compelled to resurvey it. 53.00 ch-The 1/4 sec corner. (Meldrum does not call destroying marks referring to R37E). Corner remonumented from original GLO corner evidence in 1972 by Douglas M. Ferguson, OPLS 848. His record states: Found remains of original post from ground level to a depth of approximately 15 inches. Found a 16 in tamarack, live in good condition, with scribing visible, bearing S24°W 3.8 ft from original post. Found a 12 in spruce, live in good condition, with scribing visible, bearing S11°E 11.2 ft dist from the original post. Accepted post as corner position. Set 30 in x 2 1/2 in iron pipe with 3 in brass cap marked as shown, (markings shown below) 26 in in the ground for the East 1/4 corner to Section 1. No new bearing trees taken. Set a steel fencepost approx. 5 feet East from corner. No record of subsequent monumentation found in Umatilla County survey records.

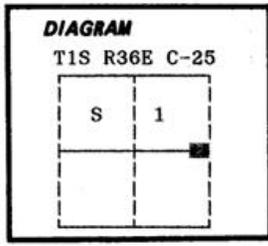

Description of corner evidence found:

Found a 3" brass cap monument marked as shown:

ORIGINAL BEARING TREES:


Found a 14 inch diameter Spruce S11°E, 11.2 feet, live but sickly with scribes visible.

Found a 16 inch diameter Western Larch S24°W, 3.8 feet, dead and down with scribes visible.

Found a steel fencepost approximately 5 feet East with a Land Survey Monument sign attached.

Distance to the original BTs is to the estimated face of blaze.

See map of survey dated September, 1989.

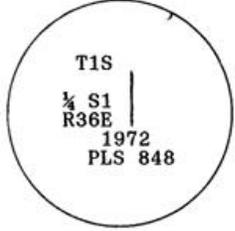

Description of monument and accessories established to perpetuate the

original location of this corner: From the above described corner monument:

New Bearing Trees:

A 18 inch diameter Spruce bears S54°W, 20.31 feet marked 1/4 S1 BT
A 8 inch diameter White Fir bears N66°W, 19.57 feet marked 1/4 S1 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

I hereby certify that the above corner point was perpetuated as hereon described on July 30, 1989.



I used a steel tape and magnetic compass in the location of existing accessories. I used 20° East magnetic declination.

Office of The Survey Dept. County of Umatilla
 State of OR I hereby certify that the within instrument was filed in this office
 for record on the 27 day of October 1989
David H. Kumbier by Kathleen K. Ambsberry
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor
 Date 10-89
 by KA
 No. 89-101-B

*GPO-591-971, 1988