

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-19

**History of original corner establishment:**


Corner originally established by Herman D. Gradon under General Land Office Contract No. 452, June 16, 1882. Surveyor General Records state: Set a basalt stone 18 x 8 x 8 ins. 12 ins. in the ground for 1/4 corner marked 1/4 on N face, from which

- A fir 22 in. diam. bears N85°E 32 lks. dist. marked 1/4 S. BT.
- A fir 12 in. diam. bears S45°W 19 lks. dist. marked 1/4 S. BT.

Corner resurveyed by Douglas M. Ferguson, PLS 848, November 1972. His record states: Found 36 in. fir, live in good condition, with scribing visible. Established corner position S85°W 21.1 ft. from bearing tree. (recorded as Certified Land Record no. H-158-R) See sheet 2 for continuation of history record.

**Description of corner evidence found:**

- Found 2 1/2" iron pipe with 3" brass cap, marked as shown in corner diagram.
- A 38" douglas fir bears N 83° E (N 85° E with Declination 20° E) - 21.1 feet, with healed blaze.
- A 26" ponderosa pine bears S 17 1/2° E - 46.5 feet, pitched over, with scribing.

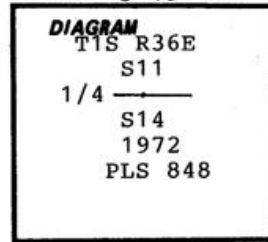

**Description of monument and accessories established to perpetuate the original location of this corner:**

Set a steel fence post 5 feet East of monument with 54-2 and 54-9 signs attached.

**New bearing trees established:**

- A 16" douglas fir bears S 49 3/4° E - 26.1 feet, scribed: 1/4 S14 BT.
- A 16" douglas fir bears N 7° W - 49.0 feet, scribed: 1/4 S11 BT.

New bearing trees have a brass washer stamped 'PLS 1106' nailed to the face of the blaze. Attached 54-3 and 54-9 signs, painted a 6" band and face of blaze red.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on July 22, 1994.

Compass declination 18° East.

Sheet 1 of 2 (continued on page 2)

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

*renews 12-31-94*

Office of Surveyor County of Umatilla  
 State of Oregon I hereby certify that the within instrument was filed in this office  
 for record on the 7 day of December, 1994  
*David H. ...* by \_\_\_\_\_ (DEPUTY)  
 (COUNTY OFFICIAL)

Form R6-7100-57 (9/71)


RECEIVED BY  
 Umatilla County Surveyor  
 Date 12-94  
 Rec'd By KK  
 No. 94-170-B

\*GPO-591-971, 1988

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-19

History of original corner establishment:  
History Record continued from page 1.  
Set a 30 in. x 2½ in. iron pipe with 3 in. brass cap, marked as shown in monument detail, 26 in. in the ground, for the 1/4 Sec. Cor. between Sec 11 & 14, from which a new BT-  
A pine 24 in. diam. bears S 16° E 45.1 ft. dist. marked T1S R36E 1/4 S 14 BT  
Distance taken to a brass washer in the blaze of the tree. Set a steel fence post approximately 5 ft. East from corner with Forest Boundary sign attached.  
(recorded as Certified Land Record no. H-158-R)

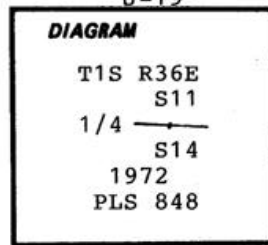

Description of corner evidence found:

Page 2 of 2

Description of monument and accessories established to perpetuate the original location of this corner:

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*  
OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

*renews 12-31-94*

Office of Surveyor County of Umatilla  
State of Oregon I hereby certify that the within instrument was filed in this office  
for record on the 3 day of December, 1994  
David H. Kline by \_\_\_\_\_  
(COUNTY OFFICIAL)

(DEPUTY)  
RECEIVED BY

Umatilla County Surveyor

Date 12-94  
Rec'd By KK  
No. 94-170-B