

USDA-FOREST SERVICE

Index

File No. N-11

**CORNER RECORD (SEARCH)**

(Ref. FSM 7151.4)

Tract or Survey No. \_\_\_\_\_ Cor. No. \_\_\_\_\_


T 1S \_\_\_\_\_ R.37E \_\_\_\_\_

R.D. WALLA WALLA County UMATILLA

Merid. WILLAMETTE

N.F. UMATILLA State OREGON

**CORNER DIAGRAM**

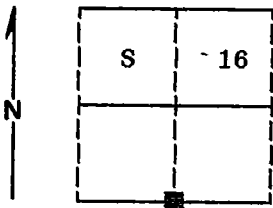

**DESCRIBE CORNER MONUMENT FOUND**

Found the rotted remains of the original post to a depth of 10 inches.  
Note: Found a small mound of stone with a rotted post (no marks visible) approximately 6 feet West of the true corner.

**DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND**

Found a 28 inch diameter White Fir S30°E, 12 lks, live with a broken top, with scribes visible.

Found a rotted Ponderosa Pine stump N40°W, 11 lks with no marks visible (Record N27°W)

**PHOTO IDENTIFICATION DATA**

Photo No. \_\_\_\_\_

Filed At. \_\_\_\_\_

Object Ident. \_\_\_\_\_

Ident. By \_\_\_\_\_

*Signature*

**PLANE COORDINATE POSITION DATA**

State \_\_\_\_\_ Zone \_\_\_\_\_

X \_\_\_\_\_

Y \_\_\_\_\_

Estab. By \_\_\_\_\_

*Agency*

*Signature*

**DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER**

Corner falls near top of ridge on timbered Southerly slope, at head of draw running Southwest, approximately 1350 feet East of the 3100 road.

Title \_\_\_\_\_  
Surveyor

Division \_\_\_\_\_

Headquarters \_\_\_\_\_

Date \_\_\_\_\_

FS-7100-52 (3/68)

8-24-89

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Set a 2½"x30" aluminum pipe with aluminum cap marked as shown:  
Pipe is set 26 inches in the ground.

T1S R37E  
S 16  
¼  
S 21  
1989  
OPLS 644

Raised a small mound of stone around monument.

ACCESSORIES : DESCRIBE NEW BTs WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

New BTs:

A 20 inch diameter Ponderosa Pine bears N7°E, 68.52 feet marked ¼ S16 BT  
A 13 inch diameter Ponderosa Pine bears S22°E, 22.08 feet marked ¼ S21 BT

Painted a 6 inch red band around all bearing trees and attached 54-3 and 54-9 signs.

Set a steel fence post approximately 5 feet East with 54-9 sign attached.

Work Done By D.I. Griffith Title Surveyor Date 8-2-89 State Registration No. OPLS 644  
or Agency

Certified Cor. Record Prepared? Yes  No  Filed At: Umatilla Co. Surveyor's Office Date 9-89

REMARKS

Witness: Rick Robinson


Index File No. N-11 T. 1S R. 37E WM. Tract or Surv. No. Cor.

LAND CORNER RECORD

22 5680.2

1. T 1S R 37E No. N-11 Cor. 4 Mer. WM State Oregon (Rectangular) N. F. Umatilla Dist. Pendleton

2. Corner Status

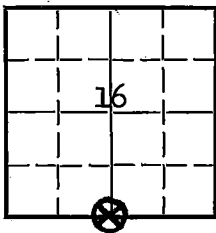

7. Photo Identification

Photo No. \_\_\_\_\_  
Ident. By: \_\_\_\_\_

8. Plane Coordinate Position Data

State \_\_\_\_\_ Zone \_\_\_\_\_  
X \_\_\_\_\_  
Y \_\_\_\_\_  
Estab. By \_\_\_\_\_  
Field Book No. \_\_\_\_\_  
Where Filed \_\_\_\_\_

9. Evaluation

Authentic \_\_\_\_\_  
Needs Verif. \_\_\_\_\_ Monument No  
Re-estab.  Survey \_\_\_\_\_  
Land Status \_\_\_\_\_

3. Original Description \_\_\_\_\_ Vol. \_\_\_\_\_ Page \_\_\_\_\_ Where Recorded \_\_\_\_\_

4. Description of Corners: Post 3 ft. long 3" square 24" in the ground marked  $\frac{1}{4}$ " S on N face.  
BT. Pine 30" dia. bears N27° W 11 lks. dist. marked  $\frac{1}{4}$ " S BT  
BT Fir 18" dia bears S30E, 12 lks dist. marked  $\frac{1}{4}$ " S. BT

5. Investigation Notes:

3" x 3" x 30" Wood post with original marking  $\frac{1}{4}$ " S  
BT-24" Fir with original marking bears S48° E 105'  
BT - Remains of a rotted N 4° W stump believed to be BT 74'

Discrepancy in both bearings & distances  
between original notes and investigation  
notes. T&H 2175

6. Signed Don Finley Title Eng'r. Tech Date 10-11-66

PERPETUATION RECORD

10. Monument:

11. Accessories

Field Book \_\_\_\_\_ Page \_\_\_\_\_

12. Set By \_\_\_\_\_ Title \_\_\_\_\_

License \_\_\_\_\_ Agency \_\_\_\_\_ Date \_\_\_\_\_

13. Recorded By \_\_\_\_\_ (Agency) \_\_\_\_\_ Volume \_\_\_\_\_ Page \_\_\_\_\_

(Date) (City) (County) (State)

14. Remarks:

N-11