

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


T 2N, R 33E., W.M.

Corner Code No. L-15

Note: Monument marked as shown below

History of original corner establishment:

This corner was most recently established by C.E. Redfield, U.S. Indian Service Surveyor, during his surveys in this area between 1917 and 1920.

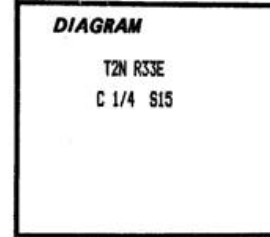

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Farming has removed all evidence of the original corner. Corner was re-established by single proportion measurement between the recovered Center South 1/16th Corner and recovered North 1/4 Corner of Section 15. This re-establishment method follows Redfield's variation of the "3 Mile Rule" used when he established the corner.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 5/8" by 30" iron pin capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106". Top of pin is 14" below ground surface.

Bearing Objects to corner:

- A 5/8" by 30" iron pin bears N 10 1/2°E - 25.0', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 5/8" by 30" iron pin bears N 67°W - 28.4', capped with a yellow plastic cap marked "W.R. WELLS, PLS 1106".
- A 1/2" by 15" iron pin bears S 69 1/2°W - 28.9'.
- A 1/2" by 15" iron pin bears S 10°E - 33.6'.

All bearing object pins have a Bearing Object sign wired on, and are buried with top of pin at least 12" below ground surface.

Set an 8' steel fence post 1.0' North of monument, and attached a Witness Corner sign.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

expires 12-31-94

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

(DEPUTY)