


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

L - 13
DIAGRAM

History of original corner establishment:

The original corner was established by George S. Pershin on September 5, 1878, under GLO contract No. 293, as follows:

Set a stone, 15" x 12" x 8", on west face of hill for 1/4 section corner.

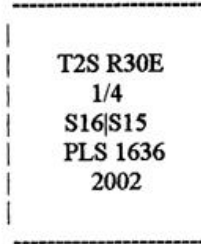

Original corner evidence recovered:

Found the original corner stone solidly set 8" in the ground. The corner stone is 14" x 11" x 6" and is plainly marked "1/4" on the east face.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 30" flared, galvanized iron pipe 24" into the ground. A 2 1/2" brass cap attached to the top of the pipe is marked as shown in the diagram above. I bury the corner stone along the east side of the pipe and build a mound of stones around the pipe, from which:

A 5/8" x 24" iron rod set 22" into the ground with a 3/4" brass washer, marked "PLS 1636 NE", attached at ground level, bears N30° E, 79.7 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 SE", attached at ground level, bears S18° 30' E, 95.4 feet. This reference is south of an east-west gully from the corner.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 SW", attached at ground level, bears S48° 30' W, 68.7 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 NW", attached at ground level, bears N38° W, 98.6 feet.

I hereby certify the above corner point was perpetuated as hereon described on June 5, 2002. Magnetic declination set in compass: 18° E.



Renews June 30, 2003

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on:

RECEIVED BY
 Umatilla County Surveyor
 Date 6-02
 Rec'd By KE
 No. 02-167-B