


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R - 5
DIAGRAM

History of original corner establishment:

The original corner was established by George S. Pershin on September 10, 1878, under GLO contract No. 293, as follows:

Set a stone, 14" x 10" x 10", for corner to sections 19, 20, 29, and 30. Dug pits and drove a willow stake as per instructions.

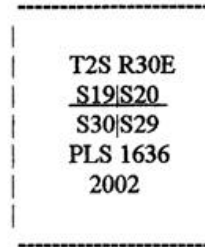

Original corner evidence recovered:

Found the original corner stone firmly set 12" in the ground. The corner stone is 16" x 11" x 9" and is plainly marked with four notches on the north edge and five notches on the east edge. The stake and pits of record are gone.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 30" flared, galvanized iron pipe 28" into the ground. A 2 1/2" brass cap attached to the iron pipe is marked as shown in the diagram above. I bury the corner stone along the north side of the pipe, from which:

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 20", attached at ground level, bears N54° E, 96.4 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 29", attached at ground level, bears S48° 30' E, 83.1 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 30", attached at ground level, bears S37° 30' W, 98.8 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 19", attached at ground level, bears N45° 30' W, 57.8 feet.

I hereby certify the above corner point was perpetuated as hereon described on February 10, 2002. Magnetic declination set in compass: 18° E.

Renews June 30, 2003

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on:

RECEIVED BY
 Umatilla County Surveyor
 Date 2-02
 By KK
 No. 02-32-R