

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


G - 17

History of original corner establishment:

The original corner was established by Daniel Chaplin on November 19, 1864, under GLO contract No. 107, as follows:

Set a stone 20" x 15" x 3" for the 1/4 section corner.

DIAGRAM

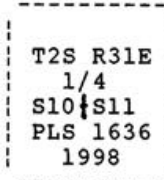

Corner evidence recovered:

The original corner stone is loosely set and surrounded by a small mound of stones. The stone is 17" x 11" x 7" and is plainly marked "1/4".

Monument and accessories established to perpetuate the original location of this corner:

At the point occupied by the original corner stone, I set a 1" x 30" iron pipe, 23" into the ground. I bury the corner stone along the north side of the pipe and build a mound of stones around the pipe to the cap. A 2 1/2" brass cap attached to the pipe is marked as shown in the diagram above, from which:

- A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer attached at ground level, marked "PLS 1636 NE", bears N44° E, 135.1 feet.
- A 5/8" x 30" iron rod set 29" into the ground with a 3/4" brass washer attached at ground level, marked "PLS 1636 SE", bears S34° 30' E, 57.8 feet.
- A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer attached at ground level, marked "PLS 1636 SW", bears S42° W, 122.3 feet.
- A 5/8" x 24" iron rod set 23" into the ground with a 3/4" brass washer attached at ground level, marked "PLS 1636 NW", bears N77° 30' W, 98.7 feet.

I hereby certify the above corner point was perpetuated as hereon described on March 18, 1998. Magnetic declination: 18° E.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

OREGON
JULY 14, 1978
DENNIS L. GAYLORD
 1636
Renew 6/30/99

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on _____, 1998.

RECEIVED BY
 Umatilla County Surveyor
 Date 4-98
 Rec'd By KK
 No. 98-46-R