

**OREGON CORNER RESTORATION FORM**

Section 33,34 Township 3N  
County Umatilla Date: 08/09/10

Range 29E

Corner Designation: 3N29X13

Corner common to sections 33,34 T3NR29E.

Condition Report Only  
 Not Found  
 Remonumented  
 Unrecorded  
 Surveyed In  
 Referenced Out


**Previous Renewals / Surveys, etc.**

Originally Surveyed by Gates. He set a post in a mound of earth in 1859.

**Monuments and Accessories Found: (Condition and Source)**

None.

**Diagram**

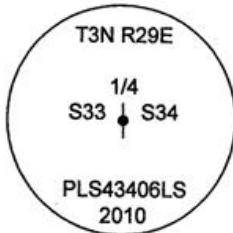

**Sketch**

Orange Magnet 22" Deep ●

Silver Magnet 23" Deep ●

○ Brass Cap 18" Deep

Blue Magnet 20" Deep ●

● Pink Magnet 22" Deep

NAD 83/91  
OREGON STATE PLANE NORTH  
INTERNATIONAL FEET

N742980.19  
E8538342.98

LAT - 45° 41' 49.445308" N  
LON - 119° 11' 02.331364" W

**Monument (s) Set (Procedures and Description)**

A 1 1/2" x 30" Galvanized iron pipe w/ a 2 1/2" Brass capped monument 18" below the surface, stamped as shown above. Set by single proportion.

**References Set:** Deep One magnets by Berntsen.

An Orange magnet, 22" deep lies N 67° W, 16.33'.

A Silver magnet, 23" deep lies N 23° E, 15.78'.

A Pink magnet, 20" deep lies S 62°30' E, 16.57'.

A Blue magnet, 22" deep lies S 17°20' W, 16.43'.

**Location and Comments**

The corner falls in an active farm field, along a N-S ridgeline, approx. 1200' E of a farm road on Piercy Farm.

**Compass Declination**

17° E

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert Douglas English*

OREGON  
JANUARY 11, 2005  
ROBERT DOUGLAS ENGLISH  
43406LS

**RECEIVED BY:**

Date: 8-10  
Rec'd By: KE  
No. 10-149-R

**Firm / Agency**

Survey One, LLC.  
P.O. Box 382  
Pendleton, OR 97801  
(541) 276-2055

RENEWAL DATE: 12/31/11