

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 11/20/12

CORNER DESIGNATION: R-17, The Southeast Corner of Section 22, Township 3 North, Range 30 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC.: Donald Staebler in 1968 under Survey No. 06-452-B for Isom and Struve, found and held a steel fence post for this corner. As of this date there is nothing left at the corner point. I reset this corner by distance-distance intersection from the West quarter corner of Section 23, and the South Quarter corner of Section 23. For the West Quarter corner Staebler held a railroad spike which is now destroyed by highway construction, I calculated the same corner position holding angles and distances from Partition Plat 2007-46. For the South Quarter corner Staebler held an old fence post, I found and held the same old fence post. See my Record of Survey for Isom filed concurrently with this corner certificate for further details.

MONUMENT AND ACCESSORIES FOUND: None. Reset corner by distance-distance intersection.

MONUMENT MARKING DETAIL:

T3N R30E

S22|S23

S27|S26

2012

PLS 54657

MONUMENT SET: At the corner point set a 2 3/8" dia. brass cap on a 1 1/4"x30" galvanized iron pipe with the top of the cap flush with the ground surface. Monument marked as shown in "Monument Marking Detail".

From which:

A silver Deep-1 magnet buried 20" below ground level bears North 50° East, 24.2 feet.

A blue Deep-1 magnet buried 20" below ground level bears South 53 1/2° East, 23.1 feet.

A orange Deep-1 magnet buried 20" below ground level bears South 48° West, 22.8 feet.

A orange Deep-1 magnet buried 20" below ground level bears North 29° West, 23.2 feet.

Buried bearing object signs with magnets.

LOCATION AND COMMENTS: Corner is located in a farmed.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

/3N30R17



RECEIVED BY

Umatilla County Surveyor

Date: 12/6/12

Rec'd By: S. Wells

No.: 12-154-B

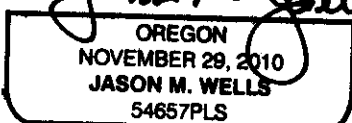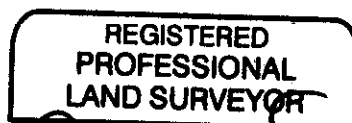

RENEWS: 6-30-14