

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 08/23/13

CORNER DESIGNATION: 3N32, R23, The North One-Quarter Corner of Section 25.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Chaplin, under Contract 107, dated September 1864, notes state: Set post for 1/4 Sec. cor. in mound of Earth with charred stake pits & c as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T3N R32E
1 S24
4 S25
2013
PLS 54657

MONUMENT SET: Held the intersection of a field berm North and South and a fence line East and West as best remaining evidence of the original corner location. Set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe with top flush with ground, 1 foot South of railroad tie post. Marked as shown in "Monument Marking Detail", from which:
A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54657", bears South 89 1/2° West, 63.6 feet.
A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54657", bears South 89 1/2° West, 21.4 feet.
A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54657", bears North 88 1/2° East, 22.7 feet.
A 5/8" x 24" iron rod with a 1 1/4" purple plastic cap stamped "Wells Surveying, PLS 54657", bears North 88 1/2° East, 57.9 feet.
Wired bearing object tags to rebar, attached witness post signs to railroad tie post 1.0 feet North of monument.

LOCATION AND COMMENTS: Corner is at a point with field berm North and South and a fence line East and West with a railroad tie field marker post 1 foot North of monument.


OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:
N= 752652.67'
E= 8647534.70'

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS
Dean Roy
\3N32R23

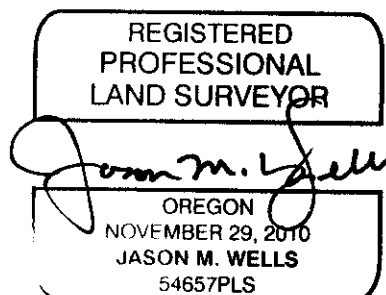

RENEWS: 6-30-14