

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 1/15/16

CORNER DESIGNATION: R-17, The Northwest Corner of Section 26, Township 3 North, Range 34 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC.: Most recent field notes for the corner by Currin and Noland under special contract dated May 4th, 1887 state: Set stone 14x10x6 ins, 10 ins in the ground for the corner to sections 22, 23, 26, and 27. Dave Krumbein, PLS 933, held the intersection of roads for the corner location in Umatilla County Survey No. I-136-B, but did not set a monument. I calculated Krumbein's position for the corner from survey I-136-B, by tying other found monuments from said survey, and holding the record interior angle and distance from found monuments. See my survey filed concurrently with this certificate for further details.

MONUMENT AND ACCESSORIES FOUND: None. Held a calculated position from Survey I-136-B.

MONUMENT MARKING DETAIL:

T3N R34E
S22|S23
S27|S26
2016
PLS 54657

MONUMENT SET: At the calculated corner point set a 5/8"x30" iron rebar with a 2" aluminum cap 1" below paved road surface at a 4-way road intersection. Monument marked as shown in "Monument Marking Detail".

From which:

A 5/8"x24" iron rebar with 1 1/4" blue plastic cap marked "Wells Surveying 54657PLS" 2" above ground level near a pasture fence corner with fences North and East bears North 46° East, 41.9 feet.

The base at ground level of a stop sign post bears South 35° East, 41.0 feet.

A 3/4" diameter brass washer stamped "PLS 1106" 1.5 feet above ground level in a utility guy pole bears South 46° West, 36.3 feet.

A 3/4" diameter brass washer stamped "PLS 1106" 1.5 feet above ground level in a power pole bears North 41° West, 35.1 feet.

Attached bearing object to rebar near fence corner and stop sign base. Nailed bearing object signs to poles near brass washers. Nailed Witness Post Sign to power pole above brass washer.


LOCATION AND COMMENTS: Corner is located at a 4-way road intersection with Johnley road North-South and Tubbs Ranch Road East-West. See map filed concurrently with this certificate for further information.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

/3N34R17

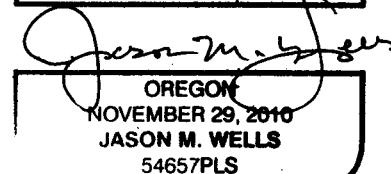

RENEWS: 6:30:16

16-008-C