


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. Z-23

History of original corner establishment:

In 1881, under GLO Contract 410, George S. Pershin set a post, from which an 8" Tamarack bears N46°W, 33.lks. and a 7" Fir bears S38°W, 9 lks.

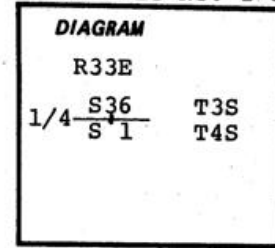

Description of corner evidence found:

No corner monument found.

Bearing trees found:

A 20" Fir bears S36°W, 5.9 ft., damaged.
A 16" W. Larch stump bears N42°W, 21.8 ft., scribing visible "BT".

Description of monument and accessories established to perpetuate the original location of this corner:

Set 2 1/2"x30" aluminum capped aluminum pipe rising 7", stamped:

New BT's:

An 8.5" W. Larch bears N27°E, 25.7 ft.,
scribed 1/4 S36 BT.
A 13.5" W. Larch bears S62 3/4°E, 17.2 ft.,
scribed 1/4 S1 BT.

T3S R33E
S36
1/4 —
S 1
1983
RLS 1848
T4S

Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982.
Set metal fence post 4 ft. north of corner.

Compass Declination: 19 1/2°E
Witness: N. Petz

From the posted line where it crosses 2110-320, follow the posted line east 1/2 mi. to corner.



I hereby certify the above described corner monument and/or accessories was established as described on October 18, 1983

Office of Surveyor County of Umatilla
State of Oregon I hereby certify that the within instrument was filed in this office
for record on the 10th day of July, 1984
David Krumbein by Betty Cochran
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

z-23

R GPO-798-276

84-81-m