

Index

File No. E-5

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or

Survey No. _____

Cor.

No. _____

T 4 N R.38 E


R.D. Walla Walla County Umatilla

Merid. Willamette

N.F. Umatilla State Oregon

CORNER DIAGRAM

T 4 N R 38 E

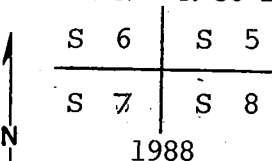

PLS 1106

DESCRIBE CORNER MONUMENT FOUND

Found a basalt stone 15x8x6" in mound of stone, could not identify any notches, from which,

A 17" ponderosa pine with scribes visible on opened blaze brs S35 $\frac{1}{2}$ ⁰E, 68.9'. (OBT)

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

A 24" dead standing ponderosa pine snag 10' high brs S23 3/4⁰W, 143.1' with scribes visible on opened blaze. (OBT)

A 16" dead standing ponderosa pine brs N66 3/4⁰W, 77.0' with scribes visible on opened blaze. (OBT)

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Corner located on a fairly open SE slope, 500' North of trail up South Fork Walla Walla River.

PHOTO IDENTIFICATION DATA

Photo No. 880-49

Filed At. Umatilla, S.O.

Object Ident. Trees

Ident. By W.R. Wells

Signature

PLANE COORDINATE POSITION DATA

State _____ Zone _____

X _____

Y _____

Estab. By _____

Agency

Signature

W.R. Wells

Title

Land Surveyor

Division

Headquarters

Pendleton, Or.

Date

8-12-88

FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

At position of food stone...

Set $2\frac{1}{2}$ " aluminum cap on $2\frac{1}{2}$ " x 30" aluminum pipe 18" in ground to bedrock & surrounded with mound of earth & stone. Set 6' fence post North of corner with sign 54-4 attached. Cap marked as shown in corner diagram. Buried corner stone in new mound.

Compass declination 12° East.

ACCESSORIES: DESCRIBE NEW BT'S, WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

New bearing trees established:

A 16" ponderosa pine brs $N32^{\circ}E$, 55.8' scribed T4NR38ES5 BT.

A 22" ponderosa pine brs $S17^{\circ}E$, 46.5' scribed T4NR38ES8 BT.

A 19" ponderosa pine brs $S59\frac{1}{2}^{\circ}W$, 92.8' scribed T4NR38ES7 BT.

A 15" ponderosa pine brs $N44\frac{1}{2}^{\circ}W$, 26.8' scribed T4NR38ES6 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-4 to each BT and painted face of blaze & 6" red band around each BT.

Work Done By W.R.Wells Title Land Surveyor Date 8-12-88 State Registration No. ORLS 1106
or Agency

Certified Cor. Record Prepared? Yes No Filed At: County Surveyor

Date

REMARKS

Index File No. E-5

T. 4 N

R. 38 E W M.

Tract or Surv. No.

Cor.

Index
File No. E - 5

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or
Survey No. _____

Cor. No. 2
Sec _____


T 4N R. 38E

R.D. Walla Walla County Umatilla

Merid. Willamette

N.F. Umatilla State Oregon

CORNER DIAGRAM

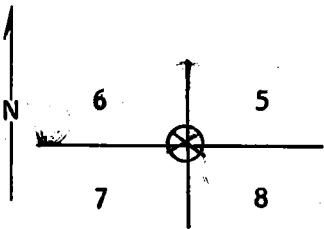

DESCRIBE CORNER MONUMENT FOUND

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

24" pine snag scribed "T4N R38E S 6 BT"
Remnants of a 36" pine scribed " 4N R38E S 7 BT" (legible)
18" pine with a face on it - did not open - but this tree fits the
G.L.O. notes

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

SEC
6 PP SNAG
7 PP SNAG
8 16" ? LINE
B.C.C. 11/76

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency

Signature John Blom Title Engr Tech Division Engr Headquarters Walla Walla

Date 3/29/71 100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

Work Done By _____ Title _____ Date _____ State Registration No. or Agency _____
Certified Cor. Record Prepared ? Yes No Filed At: _____ Date _____

REMARKS

Index File No. *E-5* T. R. M. Tract or Surv. No. Cor. _____