


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 4N , R 38E. , W.M.

Corner Code No. V-15

Notes: Monument marked as shown below

History of original corner establishment:

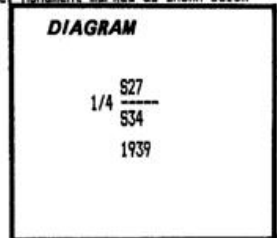

Corner was originally established by Frank Campbell under Contract No. 468, dated April 12, 1883. Original notes states:
Set a 3 in. by 3 1/2 ft post marked 1/4 S on North face and a marked stone from which:
A fir 12 ins. diam bears N 43° W 30 lks marked 1/4 S BT.
A fir, 8 ins. diam bears S 08° W 48 lks marked 1/4 S BT.

In a GLO retracement survey by Otis Gould in 1939, the original post remains were recovered and the corner was re-monumented with a 1" by 3/8" iron pipe with brass cap. Two new bearing trees were marked:
A fir, 24 ins. diam bears N 66° W 35.6 lks marked 1/4 S27 BT.
A spruce, 20 ins. diam bears S 21° E 47.5 lks marked 1/4 S34 BT.

Corner was maintained by Denny Edwards in 1985. Certificate Record No. 85-103-A states:

Found 1" iron pipe with brass cap firmly set in ground marked as in diagram and a 3/4" iron pipe 3 ft above ground driven beside it, from which:
A 24" fir stump bears N 66° W 35.6 ft no blaze or marks visible.
A 20" spruce stump bears S 21° E 47.5 ft. part of blaze and some marks vis.. visible lying by stump. (1939 bearing tree)
Edwards marked two new bearing trees:
A 9" fir bears N 70° E 8.5 ft. scribed 1/4 S 27 BT.
A 6 1/2" spruce bears S 19° W 19.5 ft. scribed 1/4 S 34 BT.

Corner No.
Compass Declination: 18.0°

Description of corner evidence found:

Found 2 1/2" brass cap on 1" galvanized iron pipe projecting 9" out of ground from which:

- A 24" fir stump bears N 66°W, 35.6' with part of face visible but no scribes visible (1939 bearing tree).
- A 20" spruce stump bears S 21°E, 47.5' with part of face and scribes in reverse visible lying by stump. (1939 bearing tree)
- A 8" alpine fir bears N 62°E, 8.5' with partly healed blaze. (Edwards)
- A 9" Englemann spruce bears S 19°W, 19.5' with partly healed blaze. (Edwards)

There is a 1 1/2" O.D. pipe, 3' high just East of monument.

Description of monument and accessories established to perpetuate the original location of this corner:

Maintained by mounding with earth and cleaned up around corner.

Marked 2 new bearing trees:

- A 9" Englemann spruce bears N 23 1/2°E, 32.1' scribed 1/4 S27 BT.
- A 15" Englemann spruce bears S 74 1/2°E, 26.8' scribed 1/4 S34 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached signs 54-3 and 54-4 or 54-9 and painted face of blaze and a 6" red band around all bearing trees.

There is a steel fence post 3' Southwest of corner with a 54-4 sign attached.

Note: Edwards bearing trees have 54-4 signs on back side of tree.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor

Date 1-92

Rec'd By KK

No. 92-01-R

☆ GPO-798-276