


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1882 by George S. Pershin under General Land Office Contract No. 430. Surveyor General's records state:
Set a post 4 ft. long 4 in. di., 2 ft. in ground on North slope for 1/4 Sec. Cor. marked 1/4 S on West face.
A tamarack 10 ins.di. brs. S16°E 19 lks. dist. marked 1/4 S BT.
A tamarack 8 ins.di. brs. West 21 lks. dist. marked 1/4 S BT.

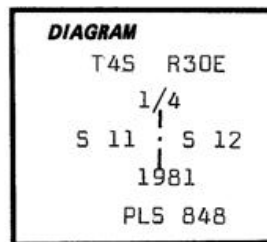

9-21

Description of corner evidence found:

No traces of original wood post found due to age and fire.

Fir has destroyed bearing trees; therefore, corner is positioned by proportion from found corners 1/2 mi. North and 1/2 mile South.

Description of monument and accessories established to perpetuate the original location of this corner:

Set 3"x30" galv. iron pipe with 3" brass cap stamped as shown on the diagram. Set 26 inches in the ground.

From which:

A pine 16 inches dia. bears N21°W, 8.8 ft. scribed 1/4 S 11 BT.
A fir 9 inches dia. bears S53°E, 23.9 ft. scribed 1/4 S 12 BT.
Set steel post with warning sign 5 ft. North from corner.
Nailed bearing tree signs and brass washers stamped PLS 848 to each tree.
Painted red band around each tree.

I hereby certify that the above corner monument was reestablished as herein described on 8/13/81.

Witnesses: D. Mitchell Ferguson

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 12, 1988
DOUGLAS M. FERGUSON
848

Mike Woodward

Office of... Co. Surveyor..... County of... Umatilla.....
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the 27th day of January....., 1982
David K. Sumner by Betty Theda
(COUNTY OFFICIAL) (DEPUTY)

82-01-C

T-2