

USDA-FOREST SERVICE


Index  
File No.            D-2  
T 4S. R. 32E  
Merid.            W.M.

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

R.D. Ukiah County Umatilla Tract or Survey No.             
N.F. Umatilla State Oregon Cor. No. SW1/16

CORNER DIAGRAM

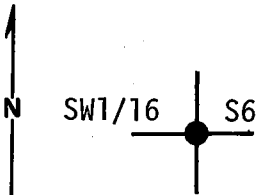

DESCRIBE CORNER MONUMENT FOUND

None Set.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

None Set.

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Corner is about 50 feet north of a fence in thick timber.

PHOTO IDENTIFICATION DATA

Photo No.             
Filed At.             
Object Ident.             
Ident. By             
*Signature*

PLANE COORDINATE POSITION DATA

State            Zone             
X             
Y             
Estab. By             
*Agency*

*Barney B. Barbour*

Title  
P.L.S.

Division            Headquarters           

Date  
11/9/77

7100-52-(3/68)

## CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

At surveyed point set 2½"x30" galvanized pipe with brass cap marked:  
Set pipe 25" in the ground.

T4S R32E  
SW1/16 | S6  
OR PLS 1051  
1977

9

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

A Fir 14" in dia. bears S24<sup>0</sup>W, 16.1', scribed SW1/16 S6 BT.  
A Fir 12" in dia. bears N66<sup>0</sup>E, 9.2 ft., scribed SW1/16 S6 BT.  
Placed 54-3s and 54-4s on trees, brass washer stamped PLS 1051 on BT blazes.  
Placed 54-2 and 54-4 on fence post 4' south and placed 54-2 and 54-9 on fence post  
3' east of corner.  
Painted 6" red bands and painted both blazes red.

10

Work Done By B.B. Barbour Title P.L.S. Date 11/9/77 State Registration No. OR PLS 1051  
or Agency

Certified Cor. Record Prepared ? Yes  No  Filed At: \_\_\_\_\_ Date \_\_\_\_\_

11

## REMARKS

Witnesses: D.L. Landers  
S. Nelson

12

Index File No.

T.

R.

M.

Tract or Surv. No.

Cor.

13