


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

L-13

History of original corner establishment:

Corner originally established by George S. Pershin, U.S. Deputy Surveyor, under Contract No. 390, dated May 12, 1881. Surveyor General records state: Set basalt stone 20x18x12 on west slope for 1/4 Sec. cor. A fir 18 in. di. brs N78°E, 32 lks. dist. Tamarack 12 in. di. brs. S52°W, 21 lks. dist.

Corner remonumented by Craig L. Wanless, BLM Cadastral Surveyor under instructions dated July 18, 1977. His record states: The 1/4 sec. cor. of secs. 15 & 16, monumented with the original unmarked

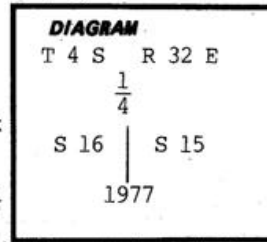

basalt stone, 20x18x12 ins., loosely set 1 in. in ground, from which the remains of the original bearing trees: A fir snag 31 ins. diam., bears N78°E, 32 lks. dist., with scribe marks 4 S visible on open blaze. A root hole bears S52°W, 21 lks. dist. (*) with scribe marks 1/4 S visible on open blaze at the corner point... Set an iron post 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd. (as shown in corner diagram) from which new bearing trees... A fir 15 ins. diam., bears N72 1/2°E, 105 lks. dist., mkd. 1/4 S15 BT. A grand fir 8 ins. diam., bears S70°W, 13 lks. dist., mkd. 1/4 S16 BT. Deposit corner stone alongside iron post. (*with a down larch alongside, 14" diam)

Description of corner evidence found:

Found 2 1/2" iron pipe with 3 1/4" brass cap (as shown in corner diagram) no stones available.

- A 12" douglas fir brs S69°W, 8.2' with scribing visible.
- A 30" douglas fir brs N74 1/2°E, 19.7' with scribing visible.
- A 18" douglas fir dead top brs. N71 1/2°E, 66.7' with scribing visible.

Description of monument and accessories established to perpetuate the original location of this corner:

Set steel fence post next to corner with sign 54-9 & 54-2 attached.

New bearing trees established:

- A 10" ponderosa pine brs N52 1/4°E, 50.9' scribed 1/4 S15 BT.
- A 15" ponderosa pine brs S82 1/2°E, 74.0' scribed 1/4 S15 BT.
- A 17" ponderosa pine brs S21°E, 32.8' scribed 1/4 S15 BT.

New BT's have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 18° East.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on June 03, 1992.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of... County Surveyor County of... Umatilla
State of... Oregon I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
Umatilla County Surveyor
Date: 7-92
Rec'd By: KR
No. 92-50-B

☆ GPO-798-276

L-13