

INDEX No. N-19

**History of original corner establishment:**


This corner was originally established George Pershin, in 1881, under GLO Contract No. 390. Surveyor General Field Notes state:

Set basalt stone 16x12x8 on land in brook bottom for 1/4 sec. cor.

A pine 14 in. diam. brs. North 27 lks dist.  
A fir 12 in. diam. brs. S40°W, 47 lks dist.

In 1977 the Bureau of Land Management (BLM) conducted a remonumentation of certain original corner points in T.4S., R.32E., W.M., under Special Instructions dated May 3, 1957, Group 350. Their record states:

The 1/4 sec. cor. of secs. 14 and 23, monumented with the original basalt stone, 16x12x8 ins., firmly set 6 ins. in the ground, mkd. 1/4 on N face, from which an original bearing tree: A fir, 26 ins. diam., bears S40°W, 47 lks. dist., with scribe mark S visible on open blaze. At the corner point set an iron post, 28 ins. long, 2 1/4 ins. diam., 22 ins. in the ground, with brass cap mkd. (SEE DIAGRAM) from which a new bearing tree: A fir, 20 ins. diam. bears N54°E, 37 1/2 lks. dist., mkd. 1/4 S14 BT. Deposit corner stone alongside iron post.

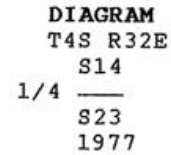

(BLM Cap)

**Description of Corner Evidence Found:**

Found an iron monument, extending approx. 6" from the ground, with a brass cap marked as shown in diagram. The monument is solid and in good shape.

White Fir snag, 28" dia., with scribing visible, bears S37°12'W, 30.6 ft. This is the original BT. (Rec: S40°W, 31.02 ft.)

White Fir snag, 16" dia., with scribing visible, bears N53°36'E, 36.9 ft. (BLM Rec: N54°E, 37.95 ft.)

**Description of monument and accessories I established to perpetuate the original location of this corner:**

No work is needed on the monument.

**From Which:**

- Western Larch, 12" dia., bears N75°00'W, 53.3 ft., scribed: 1/4 S14 BT
- Spruce, 24" dia., bears N85°45'E, 68.9 ft., scribed: 1/4 S14 BT
- Douglas Fir, 16" dia., bears S61°15'E, 27.4 ft., scribed: 1/4 S23 BT
- Western Larch, 20" dia., bears S80°15'W, 80.3 ft., scribed: 1/4 S23 BT

Measurements to BT's taken with a magnetic compass, declination 20° East, and a nylon clad steel tape. Set steel fence post with Land Survey Monument (54-9) and Property Boundary (54-2) signs 5' east and west of the monument. Nailed a brass washer stamped PLS 2405 on blaze above BT scribe as taken this survey. Nailed Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs on back of each tree as required. Painted a 6" red band above Bearing Trees signs.

REGISTERED PROFESSIONAL LAND SURVEYOR  
*Susan E. Newstetter*  
OREGON JULY 28, 1969  
SUSAN E. NEWSTETTER  
2405

This work was performed by:  
Susan E. Newstetter PLS 2405  
Witnessed by: Rick Saul and Rick Pewonka  
October 17, 1994

RECEIVED BY  
Umatilla County Surveyors  
Date 1-95  
Rec'd By KK  
No. 95-15-B

Renewal Date: 12/31/96

Office of \_\_\_\_\_ County of \_\_\_\_\_  
State of \_\_\_\_\_ I hereby certify that the within instrument was  
filed in this office for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_  
by \_\_\_\_\_

(COUNTY OFFICIAL)

(DEPUTY)

N-19