

OREGON CORNER RESTORATION FORM

SECTION 15, 16 TOWNSHIP 5 NORTH RANGE 29 EAST

L-13

COUNTY : UMATILLA DATE DEC/22

CORNER DESIGNATION

1/4 CORNER

- CONDITION REPORT ONLY
- NOT FOUND
- RENEWED
- UNCOVERED
- SURVEYED IN
- REFERENCED


PREVIOUS RENEWALS / SURVEYS, ETC.

SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101, HE SET POST AND MADE MOUND.
IN 1968 HARRIS SET A 5/8" IRON ROD.
IN 1975 KRUMBEIN SHOWED A 5/8" IRON ROD.
IN 1985 EDWARDS RESET 5/8" IRON ROD.
IN 2005 EDWARDS SET 2 3/8" BRASS CAP.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND 2 3/8" BRASS CAP STAMPED AS BELOW.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 84°45'38" W, 441.70'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 57°22'42" W, 339.54'.

MONUMENT DETAIL

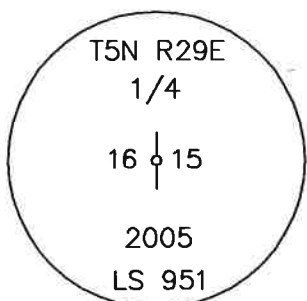

NAD 83/91
OREGON STATE PLANE
INTERNATIONAL FEET

822447.15
8537477.02

MONUMENT SET (PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

SET 5/8" X 30" IRON ROD WITH YELLOW PLASTIC CAP STAMPED PLS LS 48509 BEARS N 30°31'37" W, 115.30'.
SET 5/8" X 30" IRON ROD WITH YELLOW PLASTIC CAP STAMPED PLS LS 48509 BEARS N 09°33'43" E, 87.50'.

LOCATION AND COMMENTS

FROM INTERSECTION OF SALMON POINT DRIVE WITH HIGHWAY 730, GO NORTHERLY ALONG SALMON POINT DRIVE +/- 1 MILE. CORNER FALLS +/- 400 FEET EAST OF ROAD IN THE NORTHERLY EDGE A PIVOT CIRCLE.

FIRM/AGENCY

PRIMM LAND SURVEYING, INC.
P.O. BOX 1322
HERMISTON, OREGON 97838

LAND SURVEYOR

BRIT L. PRIMM

WITNESS

KEITH P. PRIMM

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 13, 1999
BRIT L. PRIMM
48509

EXPIRATION DATE: 12/31/24