

OREGON CORNER RESTORATION FORM

SECTION 13, 18, 19, 24 TOWNSHIP 5 NORTH RANGE 29 EAST, RANGE 30 EAST N-25
 COUNTY : UMATILLA DATE DEC/22

CORNER DESIGNATION
 SECTION CORNER

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNCOVERED
 SURVEYED IN
 REFERENCED


PREVIOUS RENEWALS / SURVEYS, ETC.

SURVEYED IN 1861 BY PAYNE UNDER CONTRACT #100, HE SET A CHARRED STAKE AND MADE MOUND.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND 3" BRASS CAP IN CONCRETE STAMPED AS BELOW. ORIGIN UNKNOWN.
 FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 51°41'33" E, 16.27'.
 FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 49°39'58" E, 26.94'.
 FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 39°51'55" W, 21.63'.
 FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 34°30'16" W, 12.91'.

MONUMENT DETAIL

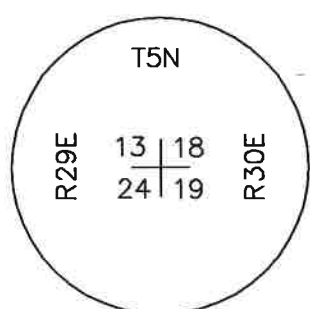

NAD 83/91
 OREGON STATE PLANE
 INTERNATIONAL FEET

820025.58
 8553335.11

MONUMENT SET (PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

LOCATION AND COMMENTS

CORNER FALLS +/- 0.4 MILES
 SOUTHWEST OF COLD SPRINGS
 HIGHWAY AND +/- 0.15 MILES
 SOUTHEAST OF AN IRRIGATION
 CANAL CORNER FALLS JUST NORTH
 OF A FEED LOT FENCE.

FIRM/AGENCY

PRIMM LAND SURVEYING, INC.
 P.O. BOX 1322
 HERMISTON, OREGON 97838

LAND SURVEYOR

BRIT L. PRIMM

WITNESS

KEITH P. PRIMM

SURVEYOR'S SEAL

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Brit L. Primm
 OREGON
 JULY 13, 1999
 BRIT L. PRIMM
 48509

EXPIRATION DATE: 12/31/24