

OREGON CORNER RESTORATION FORM

SECTION 20, 21 TOWNSHIP 5 NORTH RANGE 29 EAST
COUNTY : UMATILLA DATE DEC/22

P-9

CORNER DESIGNATION

1/4 CORNER

CONDITION REPORT ONLY

- NOT FOUND
- RENEWED
- UNCOVERED
- SURVEYED IN
- REFERENCED


PREVIOUS RENEWALS / SURVEYS, ETC.

SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101, HE SET POST AND MADE MOUND.
IN 2005 LS 951 SET A 2 3/8" BRASS CAP.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND 2 3/8" BRASS CAP STAMPED AS BELOW.
FOUND CONCRETE NAIL IN PIVOT PAD BEARS N 48°08'42" E, 240.97'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 86°23'08" E, 239.39'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 74°42'01" E, 235.56'.
FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 60°22'31" E, 250.44'.

MONUMENT DETAIL

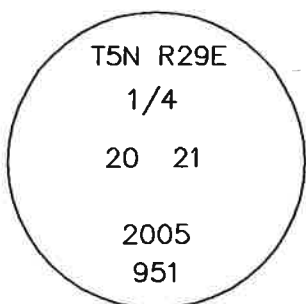

NAD 83/91
OREGON STATE PLANE
INTERNATIONAL FEET

817024.33
8532278.68

MONUMENT SET (PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

LOCATION AND COMMENTS

FROM INTERSECTION OF CRAIG ROAD
AND HIGHWAY 730 GO
SOUTHEASTERLY ALONG HIGHWAY
730 +/- 1 MILE. CORNER FALLS
SOUTH OF HIGHWAY 730 +/- 900
FEET AND SOUTHWEST OF CENTER
PIVOT +/- 240'

FIRM/AGENCY

PRIMM LAND SURVEYING, INC.
P.O. BOX 1322
HERMISTON, OREGON 97838

LAND SURVEYOR

BRIT L. PRIMM

WITNESS

KEITH P. PRIMM

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Brit L. Primm
OREGON
JULY 13, 1999
BRIT L. PRIMM
48509

EXPIRATION DATE: 12/31/24