

OREGON CORNER RESTORATION FORM

SECTION 20 TOWNSHIP 5N RANGE 29E R-5

COUNTY: UMATILLA DATE 7/91

CORNER DESIGNATION

SW Corner

CONDITION REPORT ONLY

NOT FOUND

RENEWED

UNRECORDED

SURVEYED IN

REFERENCED OUT

PREVIOUS RENEWALS/SURVEYS, ETC.


Originally surveyed in 1861 by Davenport under Contract #101. He set post, made mound and drove charred stake. Also Kimbrell set 2" Iron pipe in 1910. (Co. Survey #306.)

MONUMENTS & ACCESSORIES FOUND: Condition and Source

Found 2" Iron pipe 1 foot below surface.

MONUMENT DETAIL

SKETCH

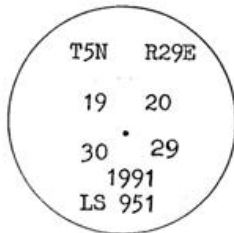

MONUMENT SET (PROCEDURES AND DESCRIPTION)

Drove 1/2" x 10" rebar inside 2" Iron pipe 6" below surface. Poured 4 1/2" diameter conc. cylinder 8" deep and placed a 2 3/8" B.C. with 1" x 3" Iron pipe over rebar 4" below surface of graveled road, stamped as above. See Co. Survey #91-058-B.

NEW ACCESSORIES From which

An Alum. tag #951 in 6" Locust fence corner Bears. N14° 22'W 18.50 ft. with Bearing Object sign,

An Alum. tag #951 in RR tie fence corner Bears. N71° 22'E 51.46 ft. with Bearing Object sign and Witness sign.

An Alum. tag #951 in RR tie fence corner Bears. S54° 20'W 35.18 ft. with Bearing Object sign attached.

Center of 6" square Telephone box Bears. S67° 56'E 50.68 feet.

LOCATION & COMMENTS

At intersection of Craig Rd. and Progress Rd.

SURVEYOR'S SEAL

COMPASS DEC.
FIRM EDWARDS SURVEYING
P.O. BOX 763, HERMISTON,
OREGON, 97838
PARTY CHIEF D. EDWARDS

NOTES
WITNESS S. BENEFIT

RECEIVED BY

Umatilla County Surveyor

Date 10-91

Rec'd By JK

No. 91-86-R

REGISTERED
PROFESSIONAL
LAND SURVEYOR

J. Dennis Edwards

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
951