

OREGON CORNER RESTORATION FORM

SECTION 36 TOWNSHIP 5 NORTH RANGE 29 EAST

Z-25

COUNTY : UMATILLA DATE DEC/22

CORNER DESIGNATION

SECTION CORNER

CONDITION REPORT ONLY

NOT FOUND

RENEWED

UNCOVERED

SURVEYED IN

REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.

SURVEYED IN 1860 BY MAXON AND HURD UNDER CONTRACT #50, THEY SET POST AND MADE MOUND.
IN 1953 U.S. FISH AND WILDLIFE SET A 3" BRASS CAP.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND 3" BRASS CAP STAMPED AS BELOW.


FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 00°51'38" E, 31.30'.

FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS N 89°56'25" W, 34.46'.

FOUND 5/8" IRON ROD WITH YELLOW PLASTIC CAP STAMPED LS 951 BEARS S 00°16'34" W, 42.92'.

FOUND 3" BRASS CAP IN CONCRETE (N.E. CORNER T4NR29E) BEARS S 89°57'21" W, 507.49'.

MONUMENT DETAIL

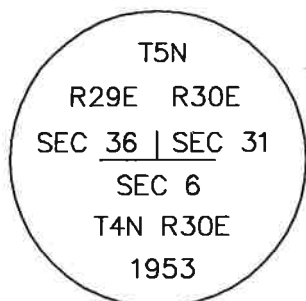

N.T.S

NAD 83/91
OREGON STATE PLANE
INTERNATIONAL FEET

804185.18
8553643.34

MONUMENT SET (PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

LOCATION AND COMMENTS

FROM THE POINT OF INTERSECTION
OF A CURVE WHERE HIGHLAND
EXTENSION TO COLD SPRINGS ROAD
TURNS EAST, GO EAST +/- 0.1
MILE TO CORNER. CORNER FALLS
+/- 1 FOOT SOUTH OF FENCE
CORNER.

FIRM/AGENCY

PRIMM LAND SURVEYING, INC.
P.O. BOX 1322
HERMISTON, OREGON 97838

LAND SURVEYOR

BRIT L. PRIMM

WITNESS

KEITH P. PRIMM

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 13, 1999
BRIT L. PRIMM
48509

EXPIRATION DATE: 12/31/24

23-012-C